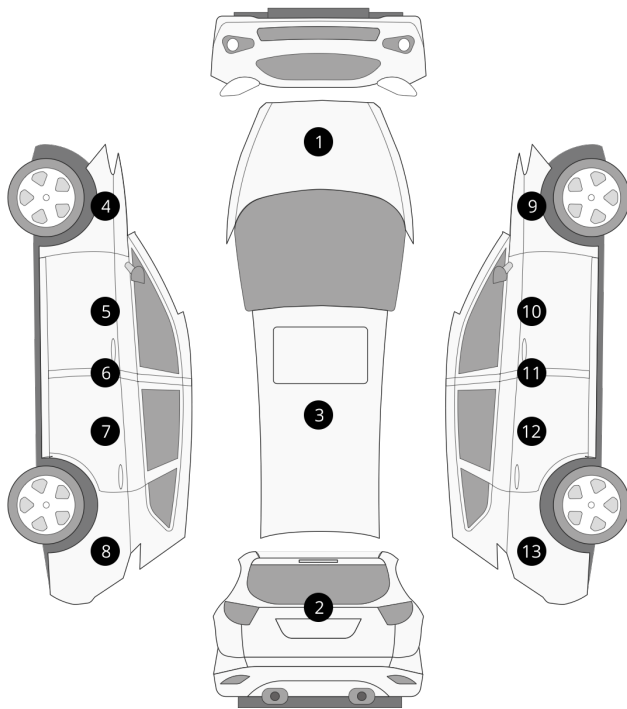


General Information

Date & Time: 24, Oct, 2025 11:14

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	10,771
Registration No.	GBC1058	Chassis No.	PA1B18F39P4232268
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



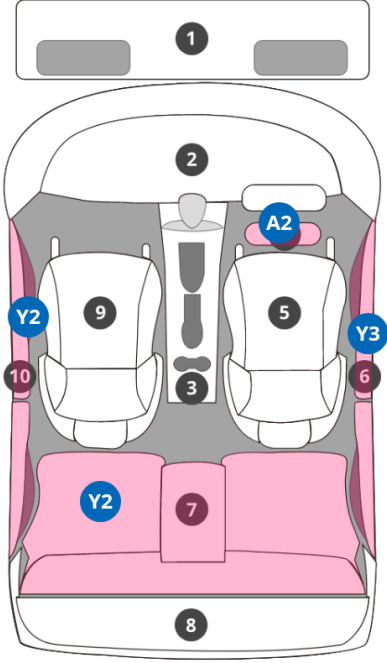
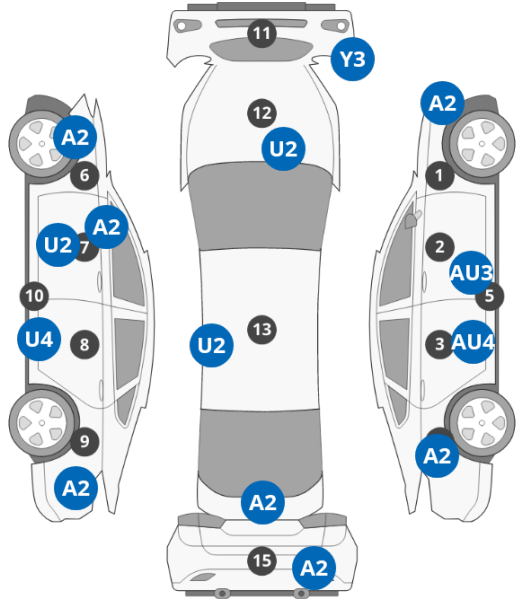
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	119.6	134	122	103
2	Boot Lid	116.3	116	118	115
3	Roof	107.2	101	106	121/101
4	Left Front Fender	103.9	113	105	94
5	Left Front Door	110.3	110	111	110
6	Center Panel Left				
7	Left Rear Door	109.3	106	111	111
8	Left Back Panel	109.0	102	117	108
9	Right Front Fender	108.3	100	105	120
10	Right Front Door	233.3	214	255	231
11	Center Panel Right				
12	Right Rear Door	379.3	165	142	831
13	Right Back Panel	151.0	119	159	175

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Cut, Crack - Small / Rear Seat - Grime - Small / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Medium	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Bonnet, Headlight - Dent - Small / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Crack, Gap - Medium / (L) Step, In-panel, Side Spoiler - Dent - Large / (L) Front Door, Molding - Dent - Small / Roof - Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet and tools/ with jack and spare tire/ with LTO plate/