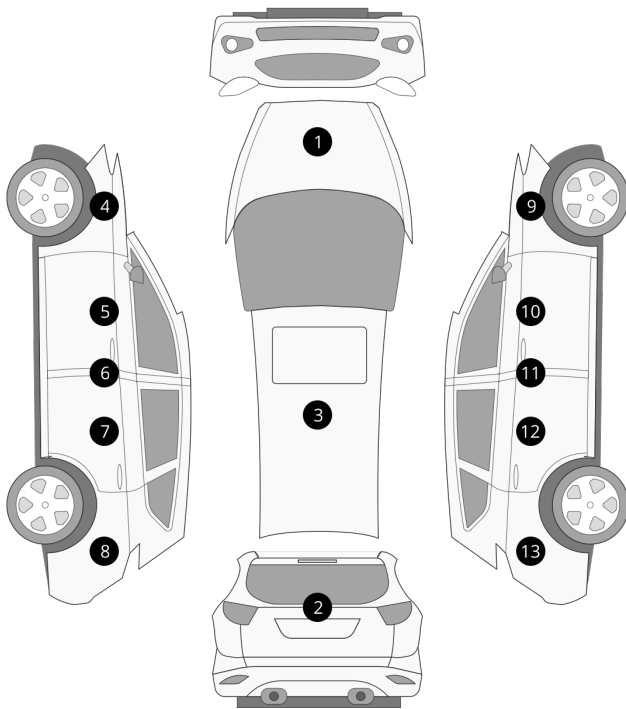


General Information

Date & Time: 23, Oct, 2025 18:58

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	8,229
Registration No.	FAQ4039	Chassis No.	PA1B18F32P4233388
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



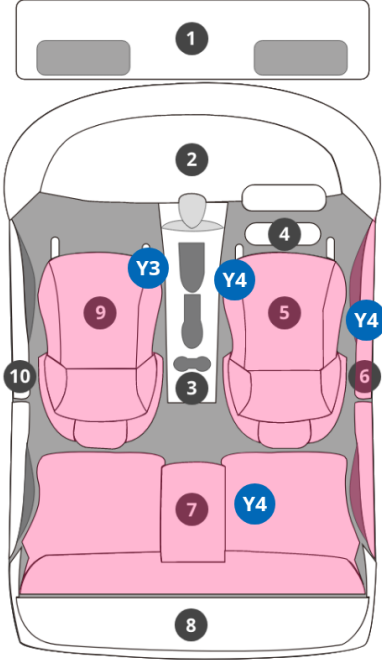
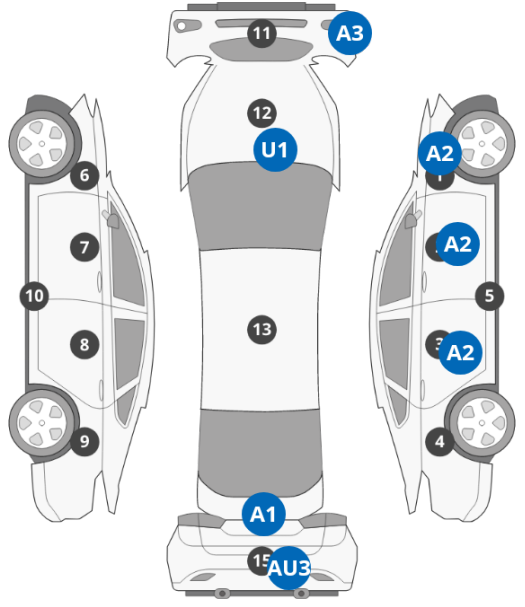
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.6	103	102	103
2	Boot Lid	110.6	116	104	112
3	Roof	103.2	105	110	96/102
4	Left Front Fender	96.3	97	95	97
5	Left Front Door	98.4	102	93	100
6	Center Panel Left				
7	Left Rear Door	105.9	116	102	100
8	Left Back Panel	108.0	110	108	106
9	Right Front Fender	101.5	102	96	107
10	Right Front Door	102.1	103	104	100
11	Center Panel Right				
12	Right Rear Door	100.7	95	99	109
13	Right Back Panel	106.6	106	105	109

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Grime - Medium / (R) Front Seat - Grime - Large / Rear Seat - Grime - Large / (R) Front Trim - Grime - Large	Remarks Front Bumper, Grille, Lamps - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Dent - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

no warranty booklet and LTO plate/ with tools/ with jack and spare tire