

General Information

Date & Time: 23, Oct, 2025 18:59

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	11,796
Registration No.	FAS5374	Chassis No.	PA1B18F38R4279861
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



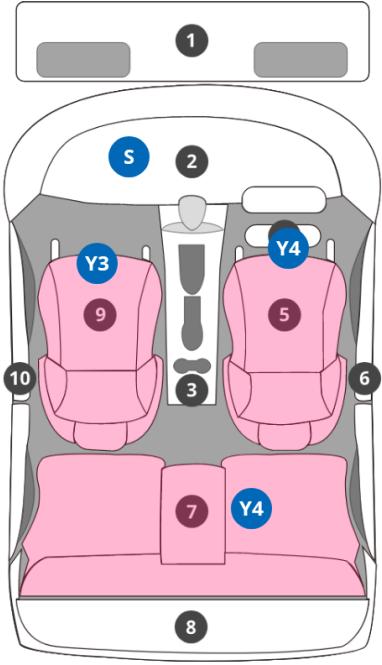
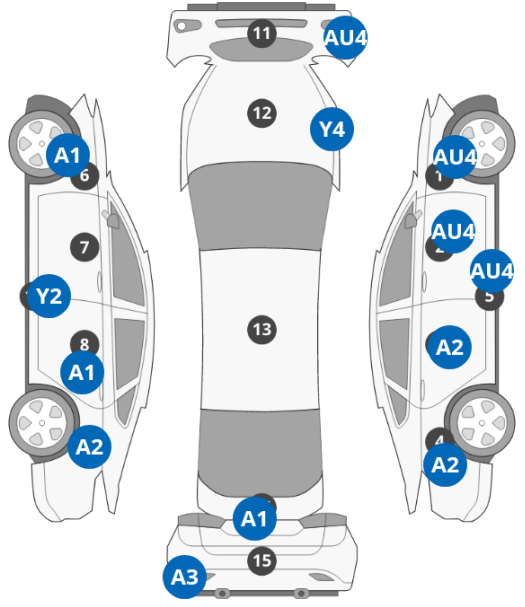
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.0	113	106	114
2	Boot Lid	108.6	104	110	112
3	Roof	110.7	112	104	109/118
4	Left Front Fender	98.9	95	100	102
5	Left Front Door	110.6	106	113	113
6	Center Panel Left				
7	Left Rear Door	107.0	109	104	108
8	Left Back Panel	105.6	103	111	103
9	Right Front Fender	107.0	107	102	112
10	Right Front Door	114.3	114	116	113
11	Center Panel Right				
12	Right Rear Door	118.6	117	117	122
13	Right Back Panel	113.0	109	111	119

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Large / (R) Front Seat - Grime - Large / (L) Front Seat - Grime - Medium / Overall Interior - Smell - Yes	Remarks (R) Front Fender, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Crack, Gap - Large / (L) Front Door, Molding - Crack, Gap - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch - Minimal
Frame Evaluation : C	Functional Evaluation : C
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Air Conditioner - Function - Weak / Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes

no warranty booklet/ front passenger door issue/ no jack and tools/ with spare tire and LTO plate