

General Information

Date & Time: 19, Sep, 2025 12:10

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	23,173
Registration No.	NHJ6629	Chassis No.	PA1B18F37P4220572
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



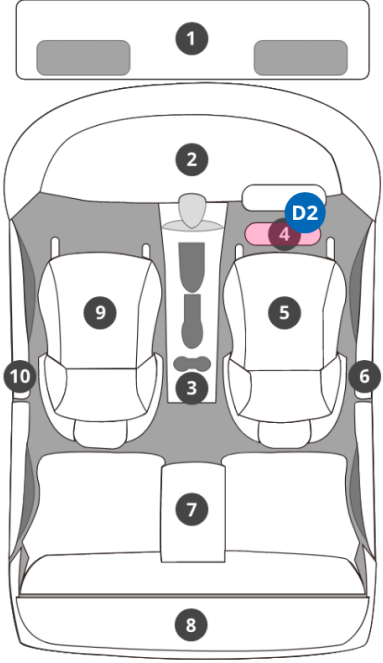
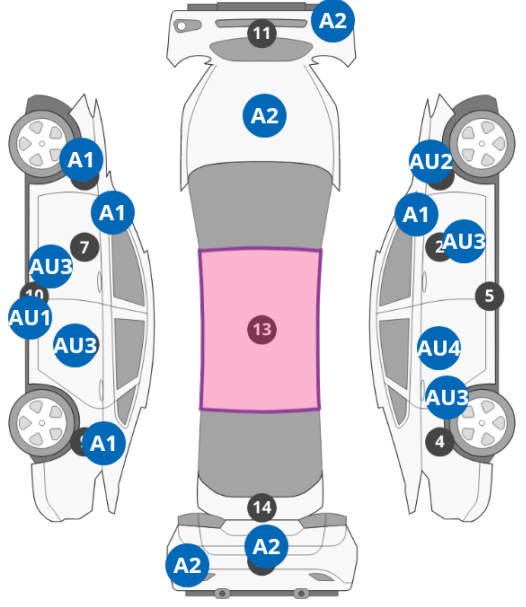
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	165.6	162	183	152
2	Boot Lid	102.8	102	99	107
3	Roof	224.5	153	410	170/165
4	Left Front Fender	97.0	97	97	97
5	Left Front Door	95.4	98	91	97
6	Center Panel Left				
7	Left Rear Door	100.7	111	94	98
8	Left Back Panel	122.3	90	142	135
9	Right Front Fender	86.6	89	88	83
10	Right Front Door	96.0	99	91	98
11	Center Panel Right				
12	Right Rear Door	142.0	137	136	153
13	Right Back Panel	149.6	137	148	164

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (L) Front Floor Mat - Worked - Small	Remarks Roof - Repair Traces - Yes / (L) Front Door, Molding - Scratch & Dent - Medium / Roof - Repair mark - Yes / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
With LTO plate and Sparetire and Jack, Incomplete Tools, No warranty booklet, No spare key and scratch headlight and tail light.