

General Information

Date & Time: 24, Sep, 2025 09:52

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	25,803
Registration No.	DBN8846	Chassis No.	PA1B18F31P4231857
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



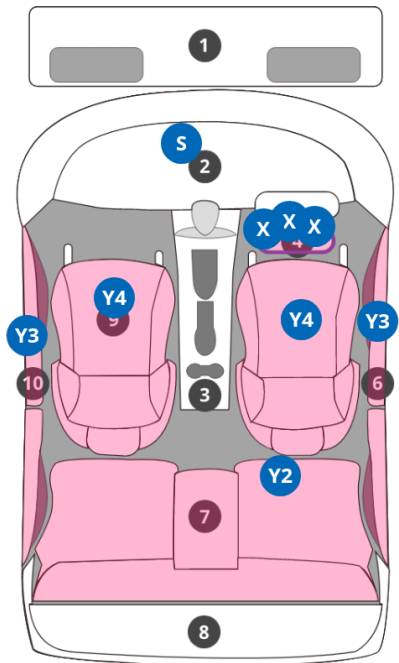
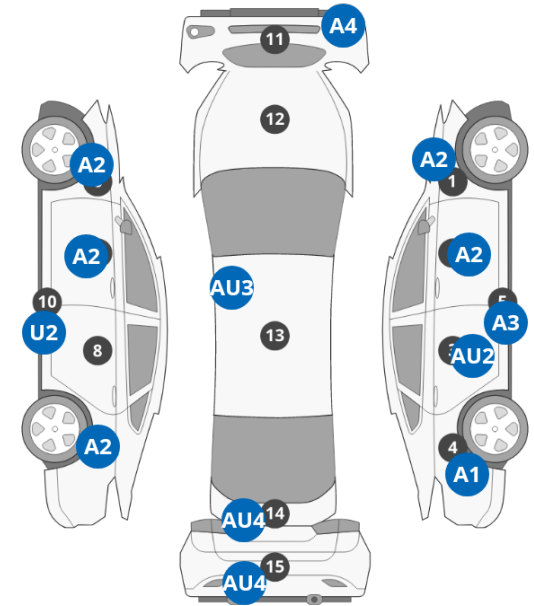
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	115.0	121	110	114
2	Boot Lid	101.6	98	100	107
3	Roof	101.2	109	104	90/102
4	Left Front Fender	94.3	94	90	99
5	Left Front Door	98.3	95	99	102
6	Center Panel Left				
7	Left Rear Door	116.6	131	126	93
8	Left Back Panel	109.6	113	113	103
9	Right Front Fender	104.0	103	100	109
10	Right Front Door	104.6	103	104	107
11	Center Panel Right				
12	Right Rear Door	102.3	102	98	107
13	Right Back Panel	111.3	107	113	114

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Worn as per age - Yes / Overall Interior - Smell - Yes / Mat Other - Missing - Yes / (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / (R) Front Seat - Grime - Large / (L) Front Seat - Grime - Large / (L) Front Trim - Grime - Medium / (R) Front Trim - Grime - Medium / Rear Seat - Grime - Small</p>	<p>Remarks Roof - Scratch & Dent - Medium / (L) Rear Door, Molding - Dent - Small / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Medium / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Large / (R) Rear Fender, Molding - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

Inspector Notes
no LTO plate and warranty booklet/ no spare tire/ incomplete tools / possible flooding