

General Information

Date & Time: 29, Sep, 2025 07:48

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	23,803
Registration No.	FAQ3503	Chassis No.	PA1B18F35P4231537
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



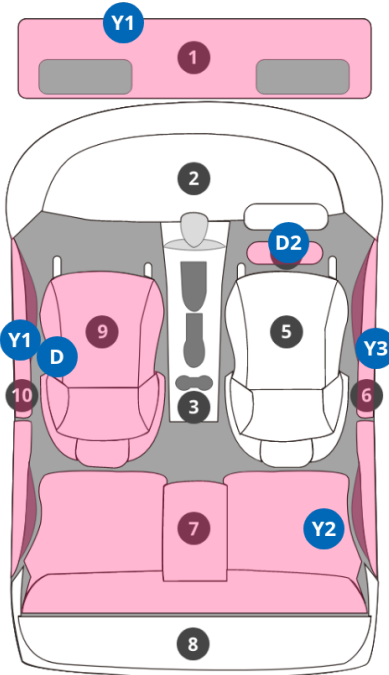
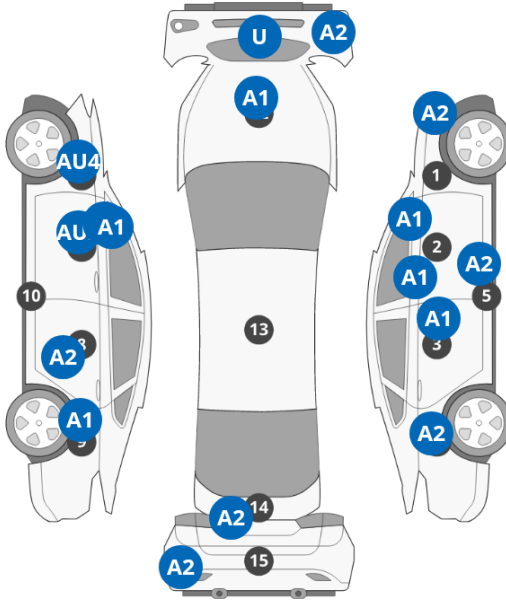
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.3	107	114	107
2	Boot Lid	102.0	105	101	100
3	Roof	101.1	102	110	94/98
4	Left Front Fender	98.2	98	94	103
5	Left Front Door	100.2	103	96	102
6	Center Panel Left				
7	Left Rear Door	102.7	107	105	96
8	Left Back Panel	101.4	114	96	95
9	Right Front Fender	104.2	109	105	99
10	Right Front Door	91.1	106	98	70
11	Center Panel Right				
12	Right Rear Door	107.1	96	103	122
13	Right Back Panel	102.1	100	100	107

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B		Exterior Evaluation : D	
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain		 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap	
Remarks Rear Seat - Grime - Small / (L) Front Seat - Worn - Yes / (R) Front Trim - Grime - Medium / (L) Front Trim - Grime - Minimal / Ceiling - Grime - Minimal / (L) Front Floor Mat - Worked - Small		Remarks (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Mirror - Crack - Damaged / (L) Mirror - Scratch - Minimal / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal	
Frame Evaluation : A		Functional Evaluation : B	
Remarks Defects not found		Remarks Retractable Mirror - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist	

Inspector Notes

no warranty booklet, no jack and tools, with spare tire, with LTO plate, scratches on tail light, damaged left side mirror