

General Information

Date & Time: 29, Sep, 2025 14:36

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	5,240
Registration No.	NKJ4648	Chassis No.	PA1B18F32R4265454
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



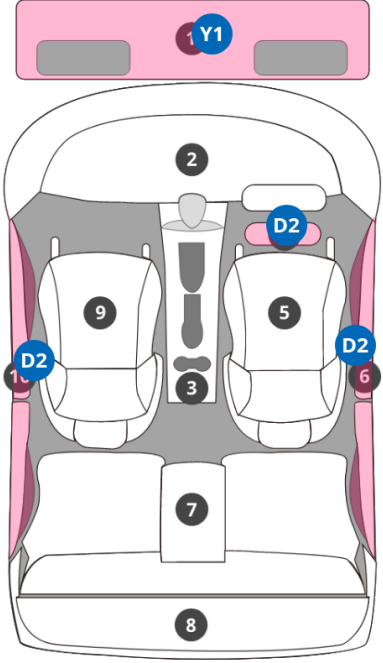
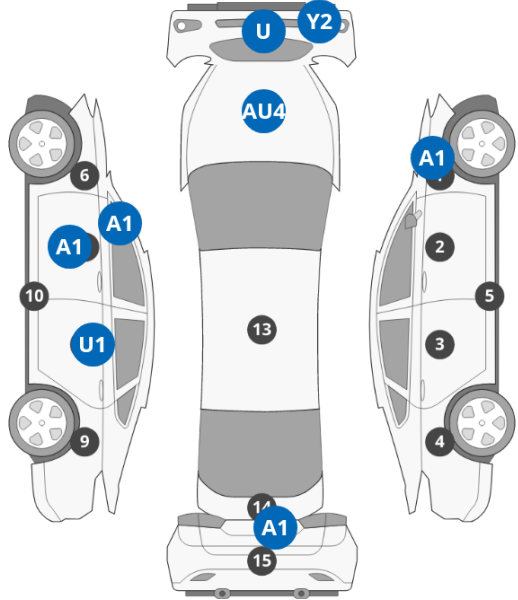
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.3	113	110	105
2	Boot Lid	98.0	97	93	104
3	Roof	97.3	102	102	92/94
4	Left Front Fender	90.6	94	90	88
5	Left Front Door	104.3	107	102	104
6	Center Panel Left				
7	Left Rear Door	106.6	114	105	101
8	Left Back Panel	105.6	114	103	100
9	Right Front Fender	97.3	98	99	95
10	Right Front Door	100.6	101	100	101
11	Center Panel Right				
12	Right Rear Door	104.3	104	102	107
13	Right Back Panel	103.3	99	97	114

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Worked - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / Ceiling - Grime - Minimal</p>	<p>Remarks (L) Rear Door, Molding - Dent - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / Member (Bolted) - Dent - Yes / Bonnet, Headlight - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Crack, Gap - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Audio, Radio - Issue - Yes</p>

<p>Inspector Notes</p>
<p>With LTO plate and Jack, No Tools and warranty booklet and Sparetire, Temporary ORCR, HEAD UNIT NOT WORKING, WORN TIRES.</p>