

General Information

Date & Time: 04, Oct, 2025 12:54

Make	Mitsubishi	Model	Xpander
YOM	2023	Odo Meter Reading	14,314
Registration No.	NIC8476	Chassis No.	MK2LRNC1WPN001275
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	Wagon
Colour	Silver		

Body / Panel Condition



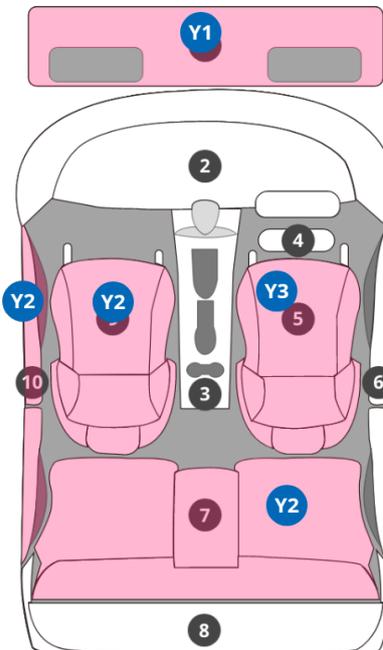
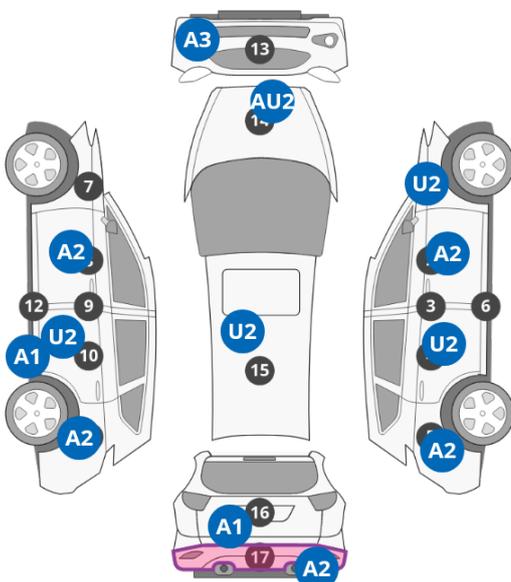
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	99.2	98	100	100
2	Boot Lid	289.6	580	123	166
3	Roof	106.8	123	109	104/91
4	Left Front Fender	88.1	93	88	84
5	Left Front Door	114.6	116	113	115
6	Center Panel Left				
7	Left Rear Door	96.5	100	92	98
8	Left Back Panel	100.5	96	100	106
9	Right Front Fender	159.0	112	195	170
10	Right Front Door	92.9	92	96	91
11	Center Panel Right				
12	Right Rear Door	88.6	88	86	92
13	Right Back Panel	128.3	141	116	128

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / Rear Seat - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Small / Ceiling - Grime - Minimal</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Door, Molding - Dent - Small / (R) Front Fender, Molding - Dent - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Door, Molding - Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch & Dent - Small / Roof - Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/With spare tire/with jack and tools/with reverse camera/No spare key/parking switch issue /No warranty booklet</p>