

General Information

Date & Time: 04, Oct, 2025 10:52

Make	Toyota	Model	Wigo
YOM	2024	Odo Meter Reading	12,844
Registration No.	CCC9159	Chassis No.	MHKAA1BC6RJ018563
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Silver		

Body / Panel Condition



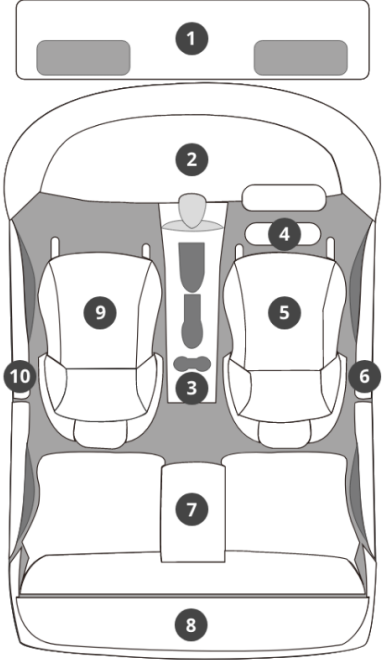
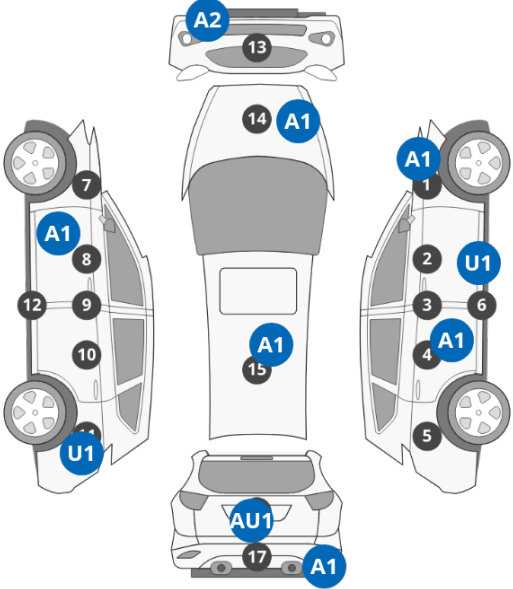
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.6	109	113	110
2	Boot Lid	86.1	84	91	83
3	Roof	90.2	98	91	90/82
4	Left Front Fender	88.1	87	93	85
5	Left Front Door	104.7	97	99	118
6	Center Panel Left				
7	Left Rear Door	99.8	107	102	90
8	Left Back Panel	94.0	102	92	88
9	Right Front Fender	83.4	82	85	83
10	Right Front Door	92.6	99	90	89
11	Center Panel Right				
12	Right Rear Door	94.1	90	93	100
13	Right Back Panel	87.2	85	89	87

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : A
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Defects not found</p>	<p>Remarks (L) Front Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Dent - Minimal / (R) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Dent - Minimal / Roof - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Defects not found</p>

<p>Inspector Notes</p>
<p>With LTO plate and Sparetire and Jack and Incomplete Tools, Warranty booklet. Scratch headlight and tail light.</p>