

General Information

Date & Time: 04, Oct, 2025 10:55

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	23,984
Registration No.	NHR2213	Chassis No.	PA1B18F36P4223916
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



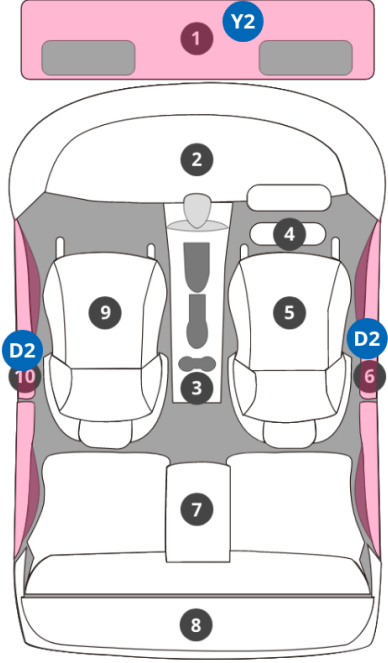
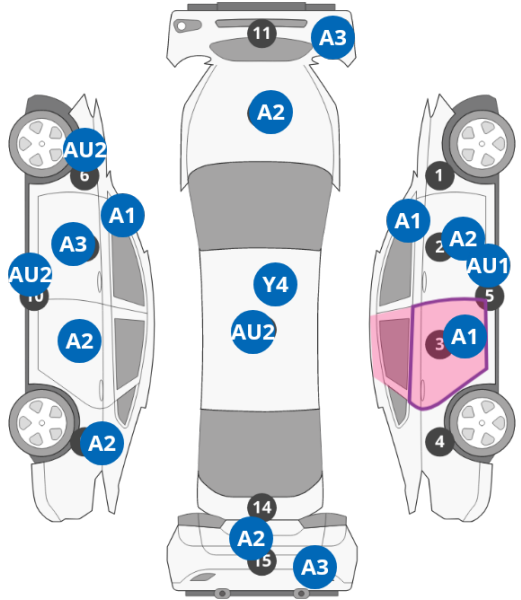
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.0	107	110	122
2	Boot Lid	108.6	107	108	111
3	Roof	102.9	105	99	108/100
4	Left Front Fender	96.4	98	95	97
5	Left Front Door	101.1	102	97	105
6	Center Panel Left				
7	Left Rear Door	110.0	122	106	102
8	Left Back Panel	108.0	111	106	107
9	Right Front Fender	99.0	103	103	91
10	Right Front Door	96.5	96	94	99
11	Center Panel Right				
12	Right Rear Door	140.6	136	142	144
13	Right Back Panel	140.6	132	135	155

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small</p>	<p>Remarks (L) Rear Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / Front Windshield - Damaged - Large / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / Roof - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Wiper - Function - Weak / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>No LTO plate, Jack and Tools, No warranty booklet and Spare tire, Scratch and Crack Tail light and Headlight, No spare key, worn tires, crack front Windshield.</p>