

General Information

Date & Time: 09, Oct, 2025 15:53

Make	Toyota	Model	Corolla Cross
YOM	2025	Odo Meter Reading	928
Registration No.	NOV5310	Chassis No.	MR2KBAAG0S0103354
CC	1.8	Transmission	CVT
Fuel Type	Hybrid	Type of Body	Wagon
Colour	White		

Body / Panel Condition



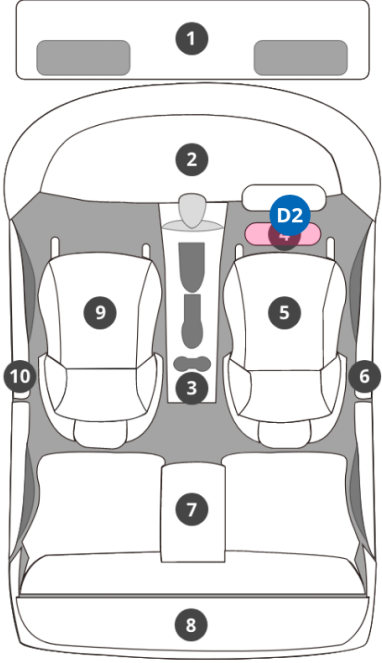
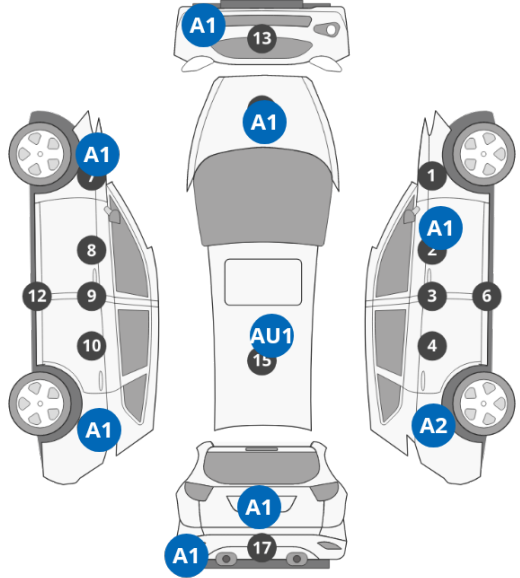
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	129.3	138	117	133
2	Boot Lid	107.0	114	105	102
3	Roof	130.2	128	141	130/122
4	Left Front Fender	111.0	105	120	108
5	Left Front Door	114.0	115	111	116
6	Center Panel Left				
7	Left Rear Door	120.6	122	115	125
8	Left Back Panel	115.3	129	106	111
9	Right Front Fender	109.6	104	111	114
10	Right Front Door	115.3	120	112	114
11	Center Panel Right				
12	Right Rear Door	117.6	114	119	120
13	Right Back Panel	124.3	129	116	128

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : A
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Worked - Small	Remarks (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / Roof - Scratch & Dent - Minimal / Bonnet, Headlight - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
With LTO plate and Sparetire and Jack and Incomplete Tools and warranty booklet, scratch headlight and tail light.