

General Information

Date & Time: 16, Dec, 2024 10:07

Make	Toyota	Model	Veloz
YOM	2023	Mileage	34,345
Registration No.	NIM8850	Chassis No.	MHFAB1BY7P3056828
CC	1.5	Transmission	CVT
Fuel Type	Gas	Type of Body	SUV
Colour	Silver		

Body / Panel Condition



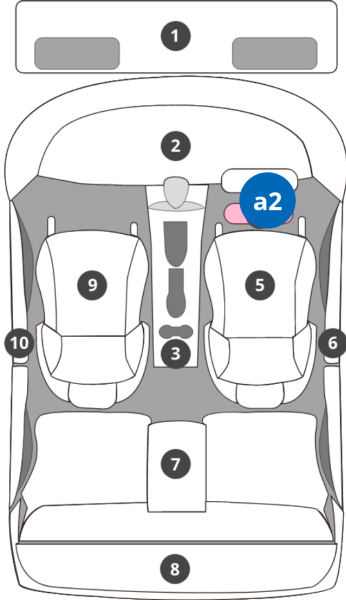
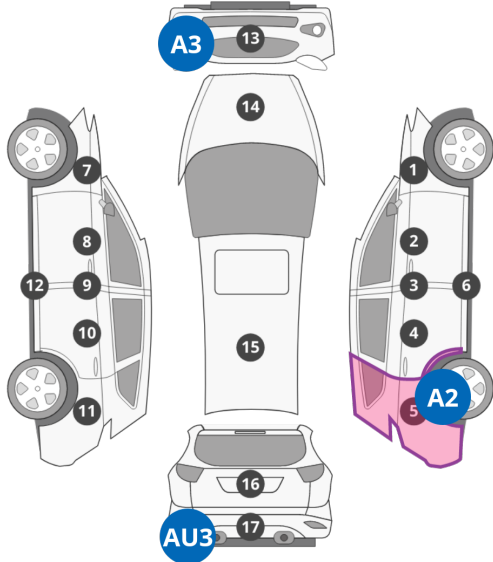
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	101.0	103	100	100
2	Boot Lid	96.3	95	103	91
3	Roof	99.5	105	96	99/99
4	Left Front Fender	102.7	98	103	107
5	Left Front Door	102.9	97	100	112
6	Center Panel Left				
7	Left Rear Door	98.1	104	92	98
8	Left Back Panel	148.3	159	148	138
9	Right Front Fender	95.5	95	98	94
10	Right Front Door	105.3	102	112	102
11	Center Panel Right				
12	Right Rear Door	128.3	125	122	138
13	Right Back Panel	366.0	337	310	451

Overall Evaluation :

A

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : A	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Cut, Crack - Small	Remarks (R) Rear Fender - Repair Traces - Yes / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
with warranty booklet/ with spare tire and tools