

General Information

Date & Time: 10, Oct, 2025 10:46

Make	Toyota	Model	Lite Ace
YOM	2024	Odo Meter Reading	27,216
Registration No.	NFR5781	Chassis No.	MHKB3FE10RK003908
CC	1.5	Transmission	M/T
Fuel Type	Gas	Type of Body	Utility Cargo
Colour	White		

Body / Panel Condition



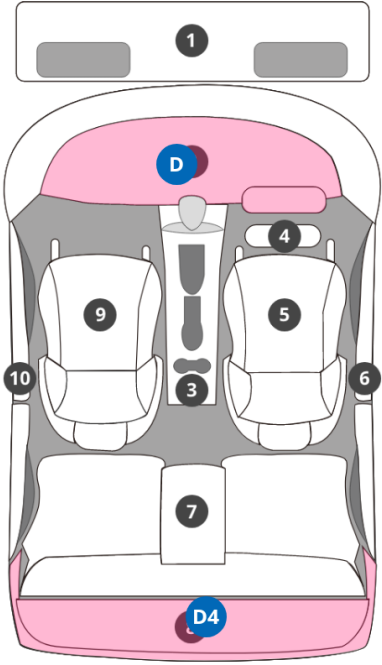
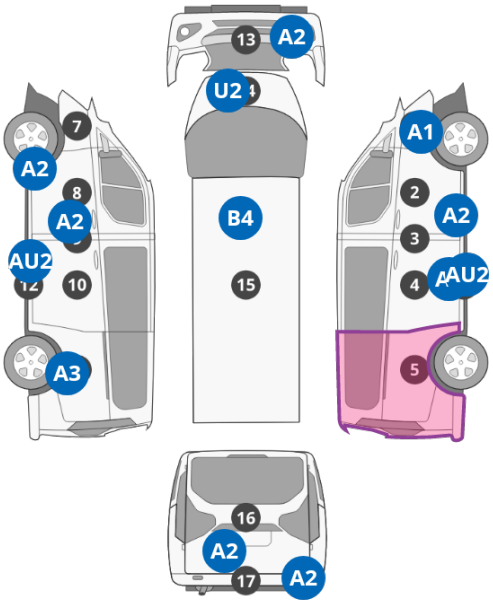
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	58.9	52	67	58
2	Boot Lid	56.8	54	75	42
3	Roof	69.9	61	51	67/101
4	Left Front Fender	53.7	49	52	60
5	Left Front Door	50.4	55	49	47
6	Center Panel Left				
7	Left Rear Door	53.2	53	54	53
8	Left Back Panel	58.2	60	54	61
9	Right Front Fender	50.8	57	46	50
10	Right Front Door	47.0	46	50	45
11	Center Panel Right				
12	Right Rear Door	52.3	53	52	51
13	Right Back Panel	285.3	429	324	103

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Traces of Adhesive Tape - Yes / Trunk Room - Loose, Deformed - Large	Remarks (R) Rear Fender - Repair Traces - Yes / Roof - Modified - Large / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Front Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Dent - Small
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Battery - Weak - Yes / Horn - Issue - Yes

Inspector Notes

no tools and jack/possible flooding/ check engine light/with LTO plate and warranty booklet / with sparetire/