

General Information

Date & Time: 10, Oct, 2025 16:46

Make	Toyota	Model	Avanza
YOM	2023	Odo Meter Reading	124,336
Registration No.	NHI4146	Chassis No.	MHFAA1BY6P0012744
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Silver		

Body / Panel Condition



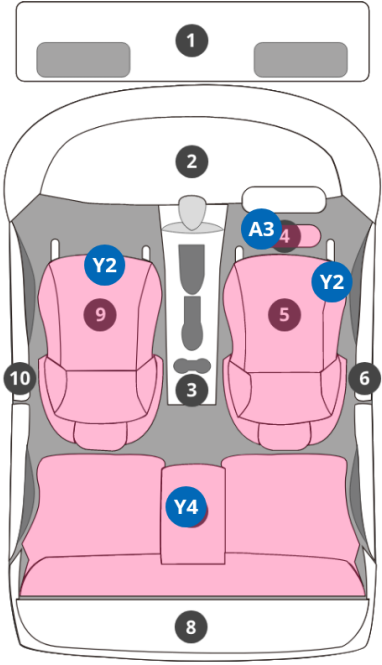
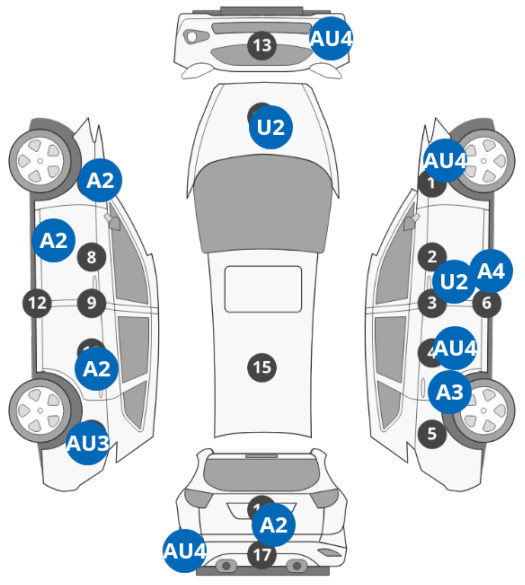
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.3	123	107	110
2	Boot Lid	114.3	114	126	103
3	Roof	112.5	123	107	107/113
4	Left Front Fender	106.1	95	104	120
5	Left Front Door	120.3	115	118	128
6	Center Panel Left				
7	Left Rear Door	119.6	120	121	118
8	Left Back Panel	114.0	119	117	106
9	Right Front Fender	108.6	116	108	102
10	Right Front Door	113.6	115	111	115
11	Center Panel Right				
12	Right Rear Door	123.3	123	120	127
13	Right Back Panel	112.6	109	106	123

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Large / (R) Front Seat - Grime - Small / (L) Front Floor Mat - Cut, Crack - Medium / (L) Front Seat - Grime - Small	Remarks (R) Front Fender, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Door, Molding - Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Large / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes

no tools/possible flooding/with jack and spare tire/ with LTO plate and warranty booklet/