

General Information

Date & Time: 09, Oct, 2025 13:27

Make	Toyota	Model	Hilux
YOM	2023	Odo Meter Reading	47,655
Registration No.	NHI8969	Chassis No.	MR0DB8CD5P0129047
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	White		

Body / Panel Condition



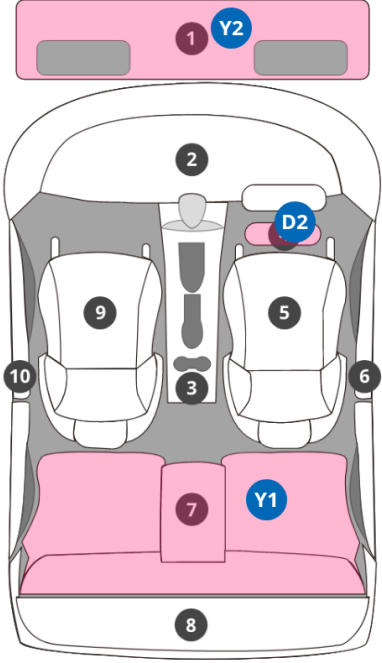
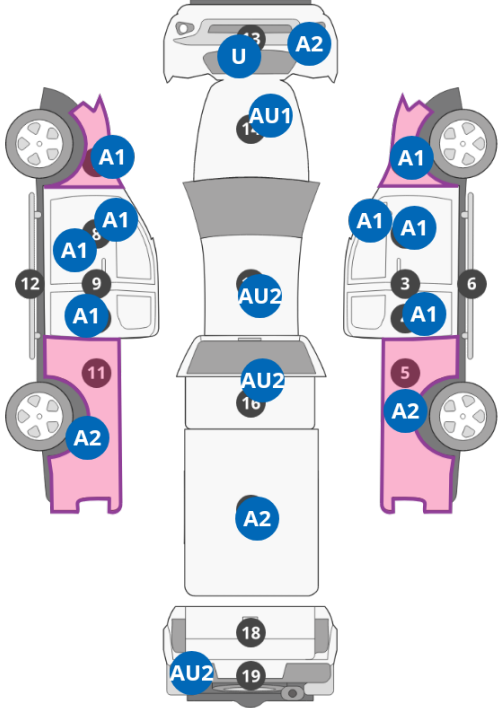
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	115.3	112	116	118
2	Boot Lid	94.2	90	86	106
3	Roof	114.2	104	109	125/119
4	Left Front Fender	99.7	94	105	100
5	Left Front Door	109.0	110	111	106
6	Center Panel Left				
7	Left Rear Door	106.0	106	106	106
8	Left Back Panel	103.6	108	102	101
9	Right Front Fender	104.2	108	109	96
10	Right Front Door	111.0	115	109	109
11	Center Panel Right				
12	Right Rear Door	109.3	107	106	115
13	Right Back Panel	101.9	100	106	100

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Minimal / Ceiling - Grime - Small / (L) Front Floor Mat - Worked - Small	Remarks Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Cargo Bed Floor - Scratch - Small / Cab Back Panel - Scratch & Dent - Small / Roof - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Member (Bolted) - Dent - Yes / (R) Side Gate - Scratch - Small / (L) Side Gate - Scratch - Small / (L) Rear Wheel, Cover - Cap Missing - Yes / (R) Rear Wheel, Cover - Cap Missing - Yes / (L) Front Wheel, Cover - Cap Missing - Yes / (R) Front Wheel, Cover - Cap Missing - Yes / (L) Front Fender, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
With LTO plate and Sparetire, No Tools and Jack and Warranty booklet, No spare key, worn tires, adhesive marks on vehicle, busted reverse light, irregular VS Form and Pending Alarm, scratch headlight and tail light.