

General Information

Date & Time: 13, Oct, 2025 10:33

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	17,478
Registration No.	NHM2620	Chassis No.	PA1B18F31P4237786
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



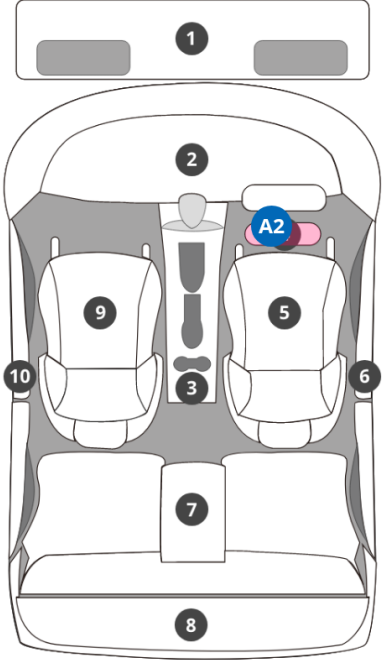
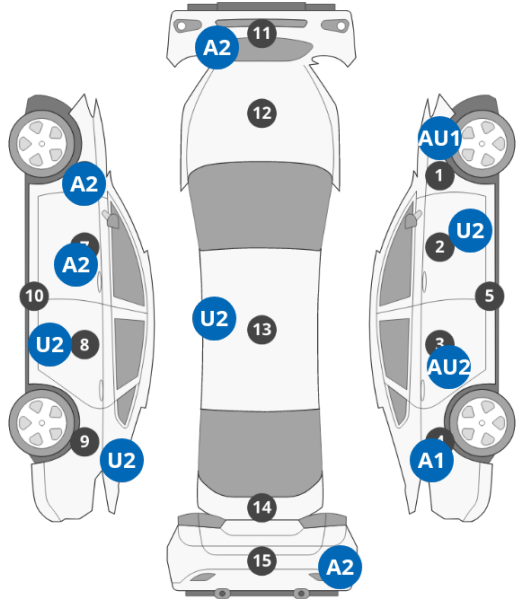
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.0	121	101	108
2	Boot Lid	103.1	100	105	105
3	Roof	99.5	103	102	95/98
4	Left Front Fender	98.1	99	92	103
5	Left Front Door	101.3	97	102	105
6	Center Panel Left				
7	Left Rear Door	105.1	121	100	94
8	Left Back Panel	105.8	113	106	99
9	Right Front Fender	97.1	94	97	100
10	Right Front Door	102.3	102	103	102
11	Center Panel Right				
12	Right Rear Door	105.0	104	102	109
13	Right Back Panel	106.8	92	104	124

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Cut, Crack - Small	Remarks Rear Bumper, Lamps, Panels - Scratch - Small / (R) Front Door, Molding - Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Dent - Small / Front Bumper, Grille, Lamps - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Roof - Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Dent - Small / (R) Rear Fender, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
with warranty booklet and LTO plate/ with jack and spare tire/ with tools