

General Information

Date & Time: 10, Oct, 2025 17:44

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	6,717
Registration No.	NHU7080	Chassis No.	PA1B18F35R4275721
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



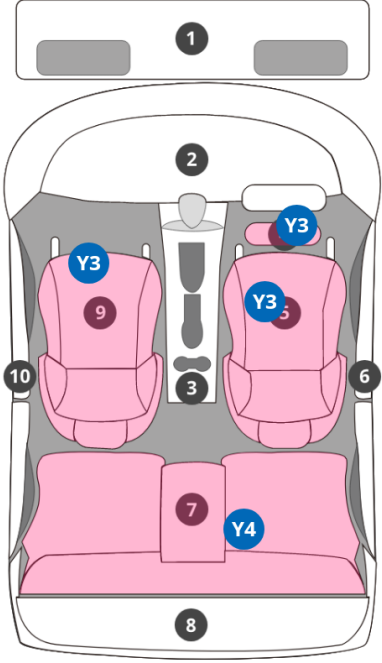
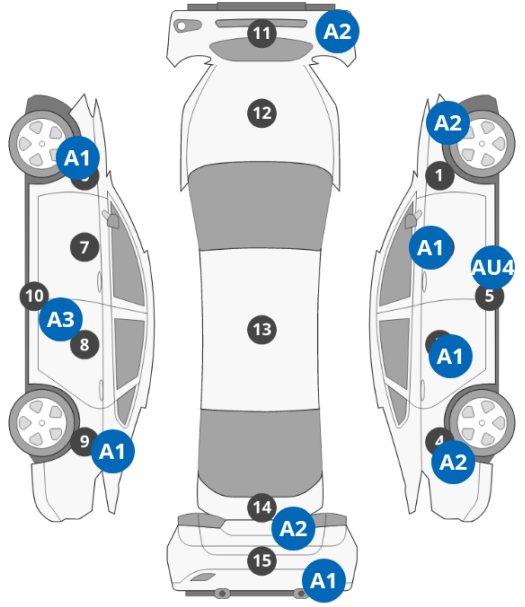
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.6	115	113	110
2	Boot Lid	101.3	103	99	102
3	Roof	101.7	101	100	110/96
4	Left Front Fender	124.6	122	123	129
5	Left Front Door	122.3	118	121	128
6	Center Panel Left				
7	Left Rear Door	142.6	125	120	183
8	Left Back Panel	132.0	143	138	115
9	Right Front Fender	96.2	96	92	101
10	Right Front Door	98.1	92	99	103
11	Center Panel Right				
12	Right Rear Door	99.0	103	98	96
13	Right Back Panel	101.4	101	98	105

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Large / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Grime - Medium	Remarks (L) Rear Door - Repair Traces - Yes / (L) Rear Door, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
with warranty booklet and LTO plate/ with spare tire and jack/ with tools