

General Information

Date & Time: 09, Oct, 2025 13:25

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	23,145
Registration No.	NIK7194	Chassis No.	PA1B18F31P4216131
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



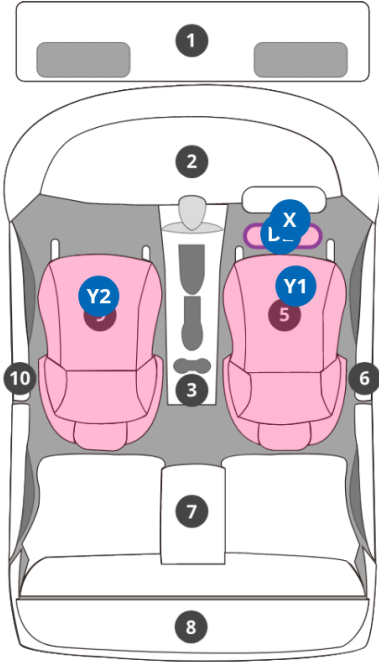
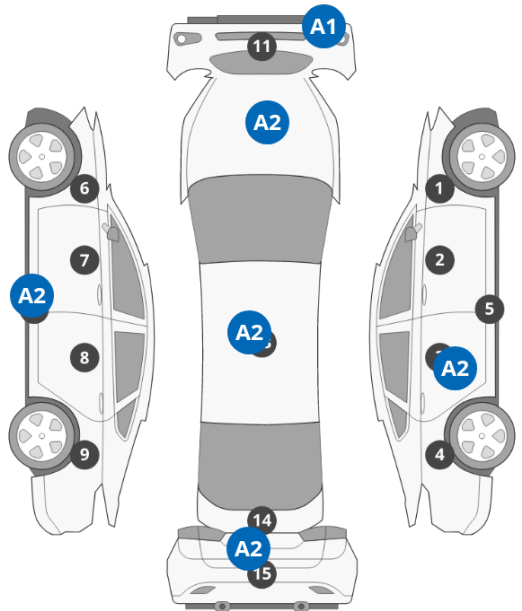
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	121.3	126	117	121
2	Boot Lid	114.6	111	119	114
3	Roof	100.2	105	108	95/93
4	Left Front Fender	99.5	97	88	114
5	Left Front Door	160.0	166	159	155
6	Center Panel Left				
7	Left Rear Door	145.6	147	146	144
8	Left Back Panel	166.3	170	159	170
9	Right Front Fender	106.3	108	106	105
10	Right Front Door	115.0	113	118	114
11	Center Panel Right				
12	Right Rear Door	114.3	111	113	119
13	Right Back Panel	155.3	166	147	153

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Worked - Small / Mat Other - Missing - Yes / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Minimal	Remarks (L) Step, In-panel, Side Spoiler - Scratch - Small / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes

with LTO plate and Spare tire and Jack, No Warranty booklet and Tools, scratch headlight and tail light, Worn Tires, adhesive marks on vehicle, Abnormal vibration on engine.