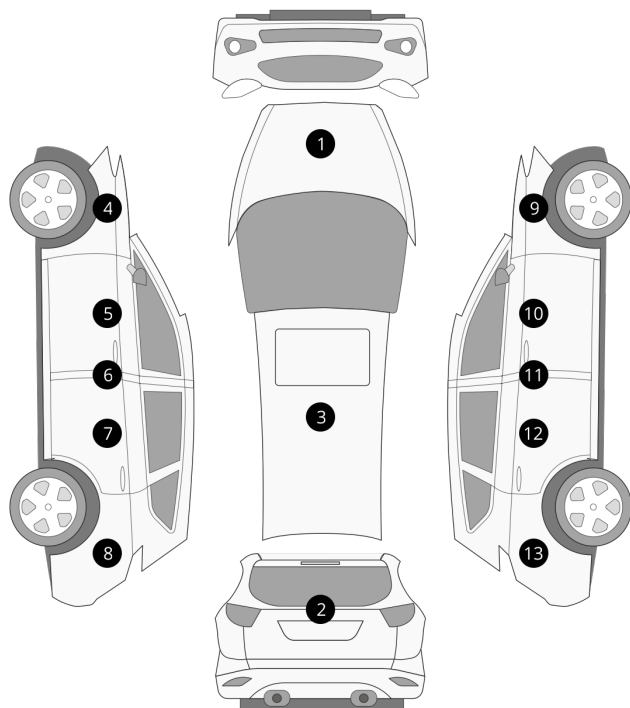


General Information

Date & Time: 09, Oct, 2025 13:24

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	15,235
Registration No.	NKH9748	Chassis No.	PA1B18F32P4219796
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



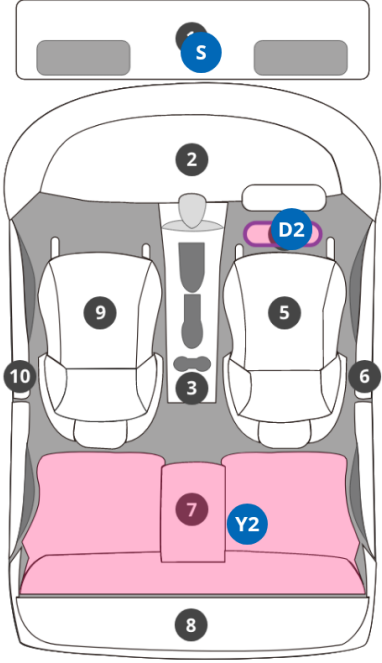
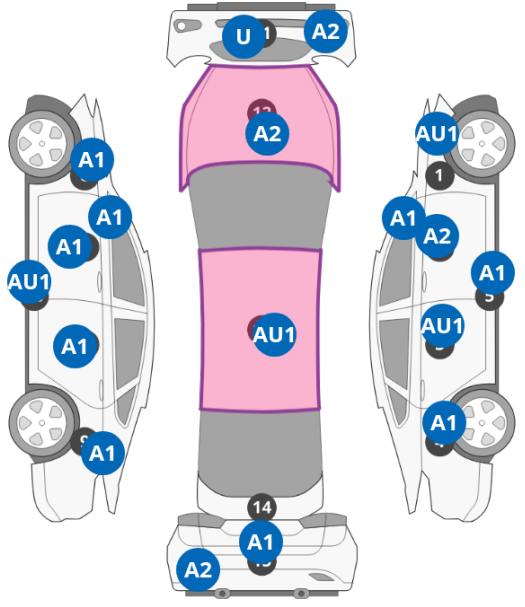
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	214.3	201	239	203
2	Boot Lid	98.2	91	101	103
3	Roof	182.5	191	195	171/173
4	Left Front Fender	98.7	102	100	94
5	Left Front Door	103.5	100	111	100
6	Center Panel Left				
7	Left Rear Door	99.4	104	94	100
8	Left Back Panel	128.3	150	136	99
9	Right Front Fender	101.5	98	99	107
10	Right Front Door	101.6	102	100	103
11	Center Panel Right				
12	Right Rear Door	103.6	101	104	106
13	Right Back Panel	122.0	108	121	137

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Mat Other - Missing - Yes / Rear Seat - Grime - Small / (L) Front Floor Mat - Worked - Small / Overall Interior - Smell - Yes	Remarks Bonnet - Repair Traces - Yes / Roof - Repair Traces - Yes / Bonnet, Headlight - Repair mark - Yes / Roof - Repair mark - Yes / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / Member (Bolted) - Dent - Yes / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Roof - Scratch & Dent - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes

With warranty booklet, No Tools and Jack and Sparetire, No LTO PLATE, Scratch headlight and tail light, Worn Tires, foul smell.