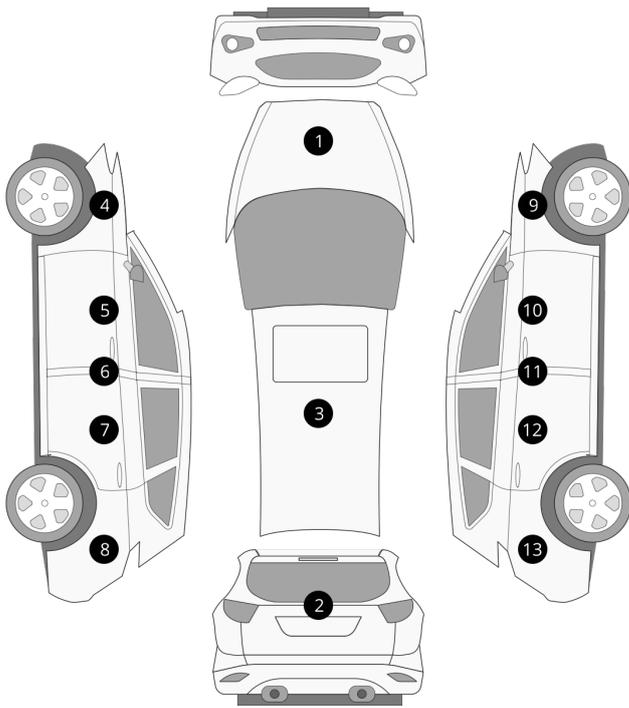


General Information

Date & Time: 06, Oct, 2025 15:58

Make	Toyota	Model	Lite Ace
YOM	2022	Odo Meter Reading	13,701
Registration No.	DBI7724	Chassis No.	MHKU3FE10NK000979
CC	1.5	Transmission	M/T
Fuel Type	Gas	Type of Body	Utility Cargo
Colour	White		

Body / Panel Condition



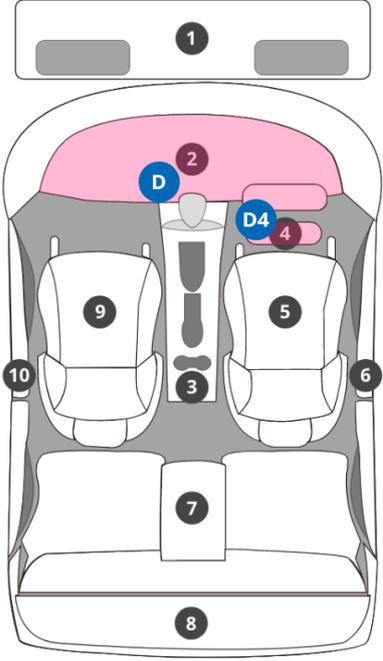
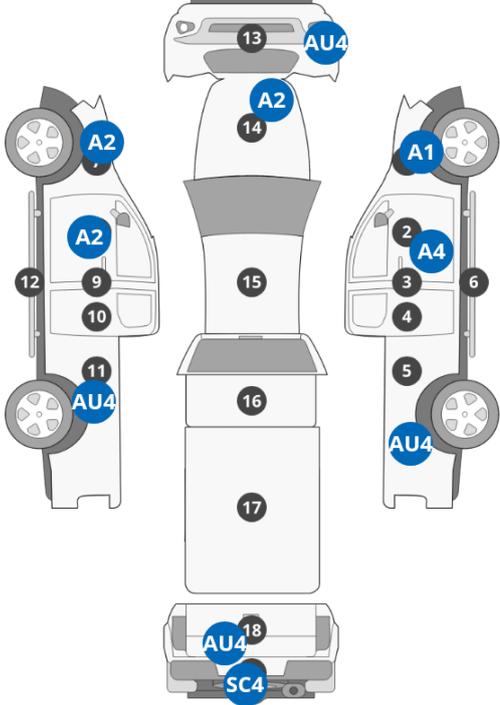
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	64.3	61	69	63
2	Boot Lid				
3	Roof	56.4	52	66	53/55
4	Left Front Fender	68.2	61	65	79
5	Left Front Door	65.2	70	65	61
6	Center Panel Left	82.8	108	69	71
7	Left Rear Door				
8	Left Back Panel	7.2	8	8	6
9	Right Front Fender	69.1	79	62	67
10	Right Front Door	60.5	57	62	63
11	Center Panel Right	63.6	70	63	58
12	Right Rear Door				
13	Right Back Panel	8.4	9	8	9

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Carpet - Worked - Large / Dashboard - Traces of Adhesive Tape - Yes	Remarks Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Side Gate - Scratch & Dent - Large / Rear Gate - Scratch & Dent - Large / (R) Side Gate - Scratch & Dent - Large / (R) Front Door, Molding - Scratch - Large / (R) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Rust, Corrosion - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet/ with spare tire/ no jack and tools/ with LTO plate/