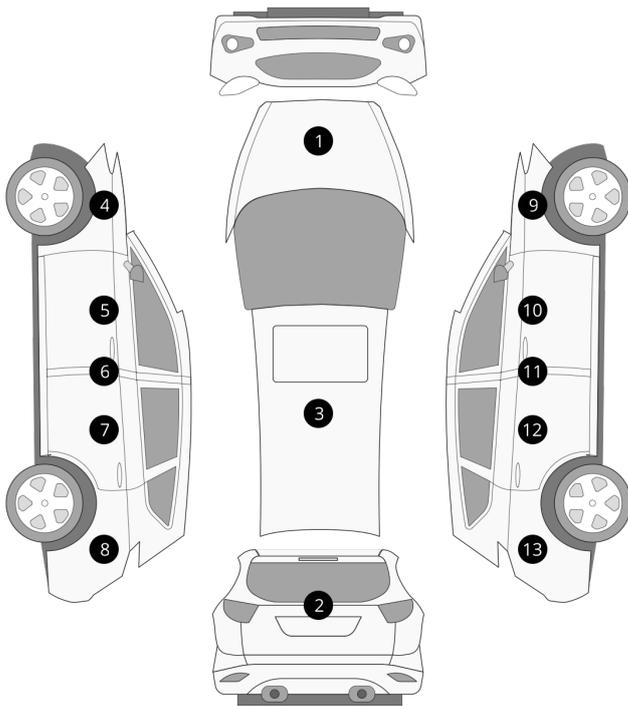


General Information

Date & Time: 06, Oct, 2025 17:02

Make	Toyota	Model	Innova
YOM	2021	Odo Meter Reading	228,242
Registration No.	NEM8557	Chassis No.	PA2JA8EM5M0098038
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Red Mica Metallic		

Body / Panel Condition



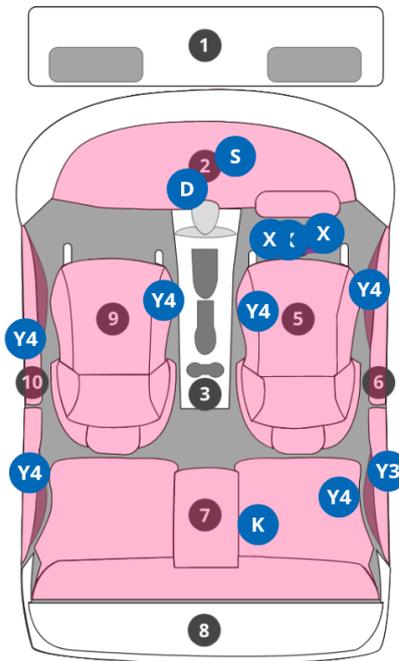
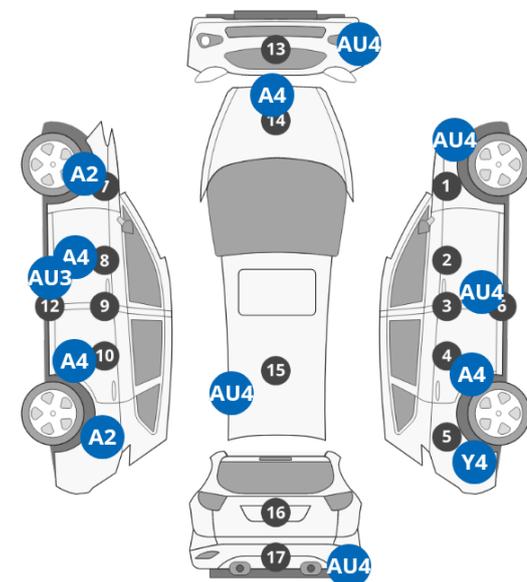
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.2	90	121	123
2	Boot Lid	104.5	116	99	99
3	Roof	102.6	105	92	97/116
4	Left Front Fender	97.8	99	104	90
5	Left Front Door	105.8	102	118	98
6	Center Panel Left				
7	Left Rear Door	102.3	103	106	98
8	Left Back Panel	106.0	107	106	105
9	Right Front Fender	101.7	93	104	108
10	Right Front Door	101.7	94	107	104
11	Center Panel Right				
12	Right Rear Door	99.1	99	97	101
13	Right Back Panel	101.3	91	106	107

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Smell - Yes / Overall Interior - Animal Hair - Yes / (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Rear Seat - Grime - Large / (R) Rear Trim - Grime - Medium / (L) Rear Trim - Grime - Large / (L) Front Trim - Grime - Large / (R) Front Trim - Grime - Large / (R) Front Seat - Grime - Large / (L) Front Seat - Grime - Large / Dashboard - Traces of Adhesive Tape - Yes</p>	<p>Remarks Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Crack, Gap - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Roof - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Large / (L) Front Door, Molding - Scratch - Large / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Large</p>
Frame Evaluation : B	Functional Evaluation : C
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Air Conditioner - Function - Weak / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes</p>

Inspector Notes
<p>no warranty booklet/possible flooding/no tools and jack/ with spare tire and LTO plate/</p>