

General Information

Date & Time: 06, Oct, 2025 14:59

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	170,965
Registration No.	DAS1589	Chassis No.	PA1B18F3XN4188164
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



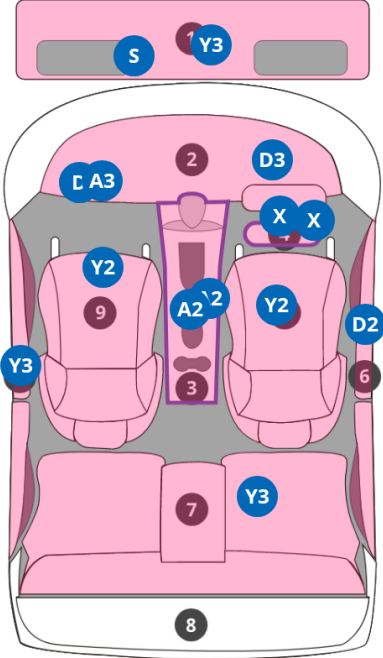
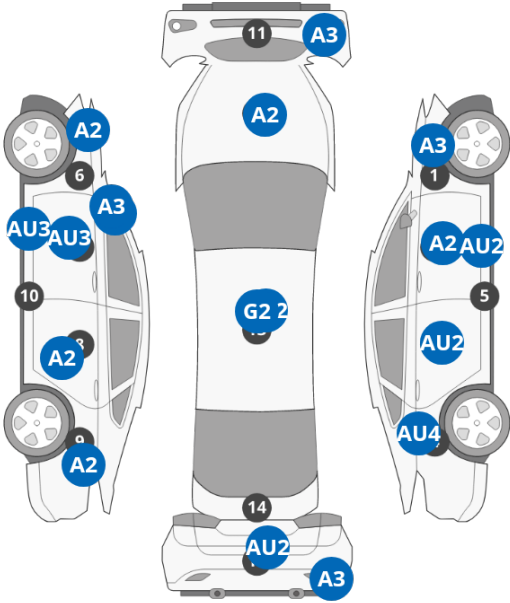
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	120.6	110	111	141
2	Boot Lid	106.0	112	100	106
3	Roof	91.6	100	89	88/91
4	Left Front Fender	97.2	101	94	97
5	Left Front Door	100.2	100	104	97
6	Center Panel Left				
7	Left Rear Door	100.9	102	100	101
8	Left Back Panel	103.3	102	106	102
9	Right Front Fender	92.5	92	96	90
10	Right Front Door	99.2	101	100	97
11	Center Panel Right				
12	Right Rear Door	97.7	92	92	109
13	Right Back Panel	102.3	108	95	104

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Medium / Mat Other - Missing - Yes / Overall Interior - Smell - Yes / Ceiling - Grime - Medium / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / (L) Front Floor Mat - Missing - Yes / (L) Front Trim - Grime - Medium / (R) Front Trim - Worked - Small / Glove Box - Loose, Deformed - Medium / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small / Dashboard - Traces of Adhesive Tape - Yes / Steering Wheel - Worn, Peel, Crack - Medium / Knobs - Worn, Peel, Crack - Small / Display, Audio System - Missing - Yes</p>	<p>Remarks Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Roof - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / (L) Mirror - Faded(Color, Gloss) - Yes / (L) Mirror - Scratch - Medium / Front Windshield - Scratch, Stone chip - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Retractable Mirror - Issue - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Parking Brake - Function - Weak / Turn Signal, Hazard Flasher - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With LTO plate on front and temporary plate in rear and Sparetire, No warranty booklet and Jack and Tools, No spare key, worn tires and Sparetire, No reverse camera not working, head unit not working, Room light issue, signal light busted, side mirror different color,foul smell, possible flooded, worn interior, retractable mirror switch issue, Abnormal vibration, adhesive marks on vehicle.</p>