

General Information

Date & Time: 06, Oct, 2025 14:58

Make	Toyota	Model	Rush
YOM	2023	Odo Meter Reading	17,839
Registration No.	NFO3299	Chassis No.	MHKE8FF3PNK047413
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	Red		

Body / Panel Condition



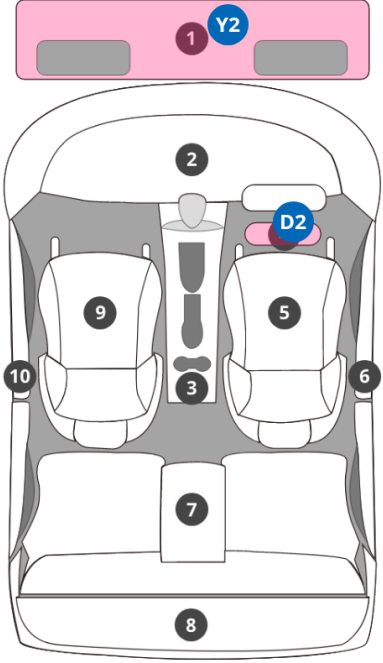
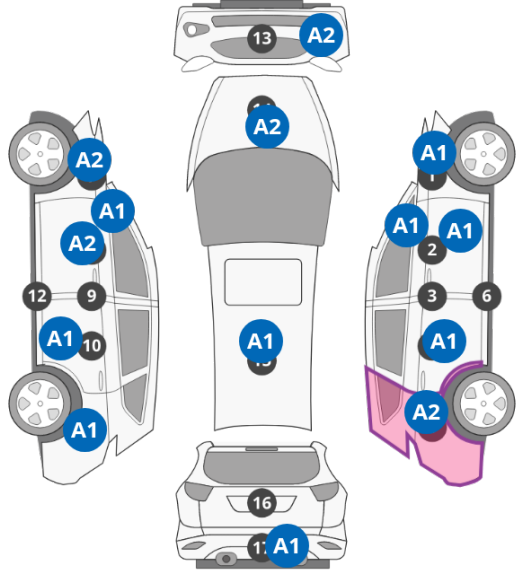
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	137.3	138	133	141
2	Boot Lid	98.7	93	101	102
3	Roof	94.9	88	91	99/102
4	Left Front Fender	103.3	101	107	102
5	Left Front Door	131.6	128	139	128
6	Center Panel Left				
7	Left Rear Door	110.6	119	111	102
8	Left Back Panel	95.8	102	95	91
9	Right Front Fender	136.3	131	142	136
10	Right Front Door	104.2	107	100	106
11	Center Panel Right				
12	Right Rear Door	150.6	161	148	143
13	Right Back Panel	152.3	133	141	183

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Small / (L) Front Floor Mat - Worked - Small</p>	<p>Remarks (R) Rear Fender - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / Roof - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With LTO plate and warranty booklet and Sparetire, No Tools and Jack and no Spare key, Scratch headlight and tail light.</p>