

General Information

Date & Time: 04, Oct, 2025 15:51

Make	Toyota	Model	Hiace
YOM	2023	Odo Meter Reading	48,813
Registration No.	NFO9796	Chassis No.	JTFNAFAP1N8027788
CC	2.8	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	White		

Body / Panel Condition



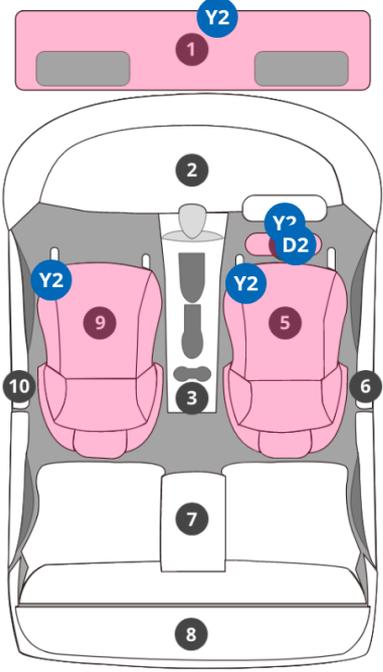
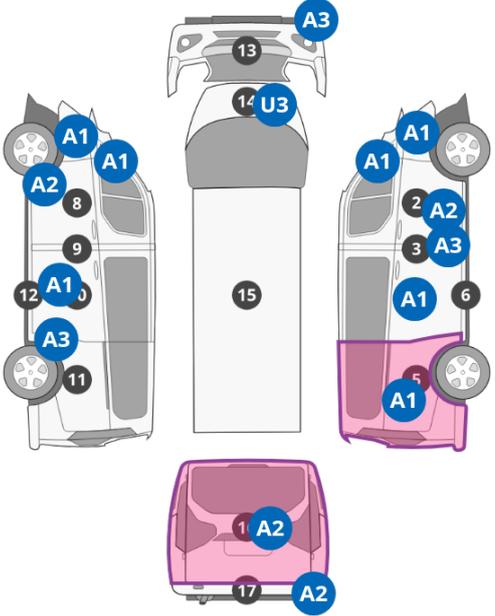
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	129.8	122	184	84
2	Boot Lid	68.8	71	71	65
3	Roof	90.4	85	83	72/122
4	Left Front Fender	82.2	81	84	82
5	Left Front Door	83.9	79	75	98
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	74.8	69	79	76
9	Right Front Fender	81.6	86	81	78
10	Right Front Door	72.7	69	74	74
11	Center Panel Right	87.5	89	96	78
12	Right Rear Door	138.3	194	116	105
13	Right Back Panel	121.5	100	107	158

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / Mat Other - Grime - Small / (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Small</p>	<p>Remarks Bonnet - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Center Panel - Scratch - Medium / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / Bonnet, Headlight - Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Medium</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet, with jack, no tools, with spare tire and LTO PLATE, scratches on tail light, brake light issue</p>