

General Information

Date & Time: 06, Oct, 2025 14:58

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	39,388
Registration No.	NFR1407	Chassis No.	PA1B18F32R4247729
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



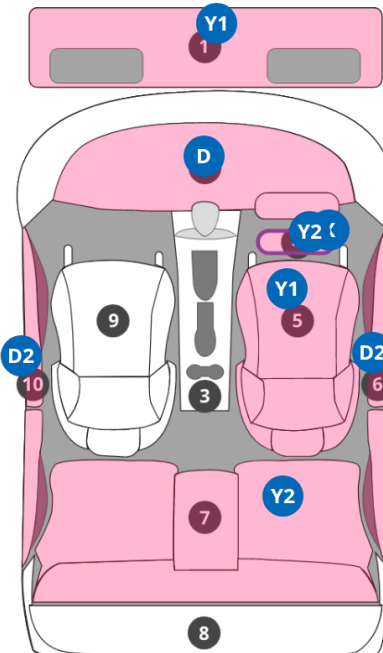
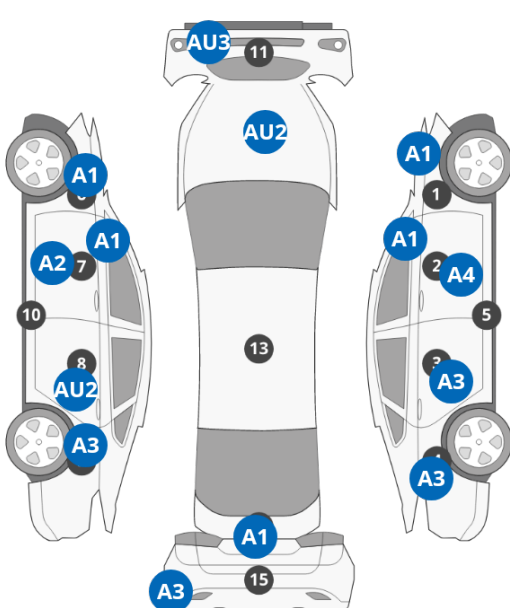
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.0	110	105	112
2	Boot Lid	98.9	107	92	98
3	Roof	93.0	89	97	88/98
4	Left Front Fender	128.6	136	128	122
5	Left Front Door	99.9	98	90	112
6	Center Panel Left				
7	Left Rear Door	141.3	142	139	143
8	Left Back Panel	100.3	101	100	100
9	Right Front Fender	96.7	97	97	97
10	Right Front Door	99.3	99	100	99
11	Center Panel Right				
12	Right Rear Door	101.6	100	101	104
13	Right Back Panel	99.4	100	98	100

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Missing - Yes / Rear Seat - Grime - Small / Mat Other - Grime - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / Dashboard - Traces of Adhesive Tape - Yes / (R) Front Seat - Grime - Minimal / Ceiling - Grime - Minimal</p>	<p>Remarks (L) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Large / (R) Mirror - Scratch - Minimal / Bonnet, Headlight - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Medium</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Defects not found</p>

<p>Inspector Notes</p>
<p>With LTO plate and Sparetire and Jack and Incomplete Tools, No warranty booklet and scratch headlight and tail light, Worn Tires and Sparetire, partially missing parts on front bumper.</p>