

General Information

Date & Time: 06, Oct, 2025 14:57

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	28,894
Registration No.	CCJ1511	Chassis No.	PA1B18F38R4276443
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



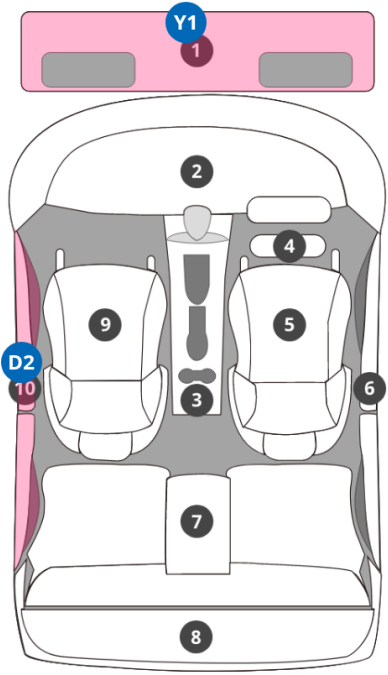
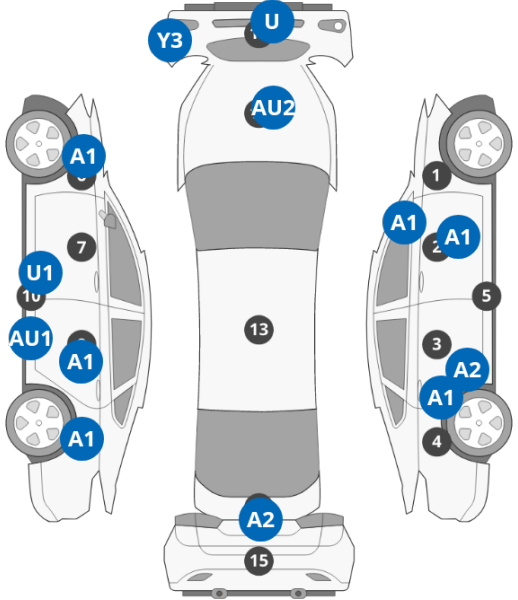
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	115.0	112	108	125
2	Boot Lid	108.3	113	101	111
3	Roof	91.1	98	87	90/90
4	Left Front Fender	97.6	101	98	94
5	Left Front Door	101.6	104	106	95
6	Center Panel Left				
7	Left Rear Door	102.6	101	103	104
8	Left Back Panel	108.0	110	104	110
9	Right Front Fender	96.8	98	93	99
10	Right Front Door	101.6	103	105	97
11	Center Panel Right				
12	Right Rear Door	98.4	95	102	99
13	Right Back Panel	103.5	101	98	112

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Trim - Worked - Small / Ceiling - Grime - Minimal</p>	<p>Remarks Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Crack, Gap - Medium / (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Dent - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / Bonnet, Headlight - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With LTO plate and Sparetire and Warranty booklet, No Tools and Jack, No Spare key, Scratch headlight and tail light, Worn Tires and Sparetire.</p>