

General Information

Date & Time: 06, Oct, 2025 14:54

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	4,045
Registration No.	CCJ3914	Chassis No.	PA1B18F3XR4272779
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



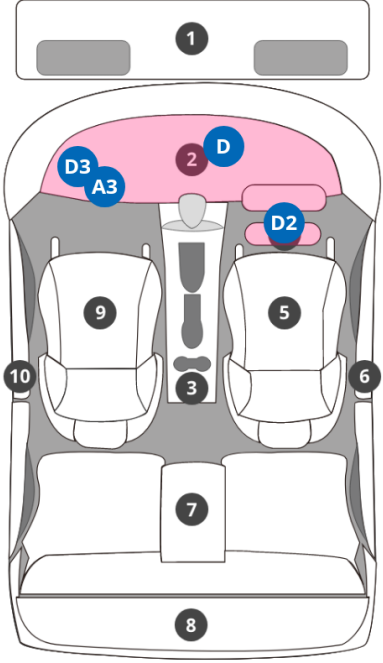
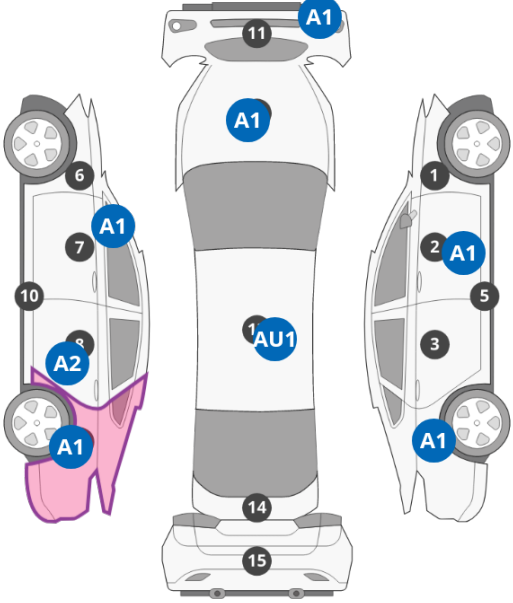
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	119.0	122	111	124
2	Boot Lid	110.9	97	119	117
3	Roof	104.0	112	102	97/105
4	Left Front Fender	103.2	105	105	100
5	Left Front Door	101.2	101	100	103
6	Center Panel Left				
7	Left Rear Door	123.0	124	120	125
8	Left Back Panel	293.6	298	332	251
9	Right Front Fender	126.6	110	132	138
10	Right Front Door	107.6	108	111	104
11	Center Panel Right				
12	Right Rear Door	109.3	107	112	109
13	Right Back Panel	114.6	108	105	131

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Dashboard - Loose, Deformed - Medium / (R) Front Floor Mat - Worked - Small / Dashboard - Traces of Adhesive Tape - Yes / Steering Wheel - Worn, Peel, Crack - Medium</p>	<p>Remarks (L) Rear Fender - Repair Traces - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : C
<p>Remarks Defects not found</p>	<p>Remarks Warning Lamps - Issue - Yes / Horn - Issue - Yes</p>

<p>Inspector Notes</p>
<p>With LTO plate and warranty booklet, No Tools and Jack and Sparetire, Scratch headlight and tail light, no air conditioning blower, warning lamps on, steering wheel replaced.</p>