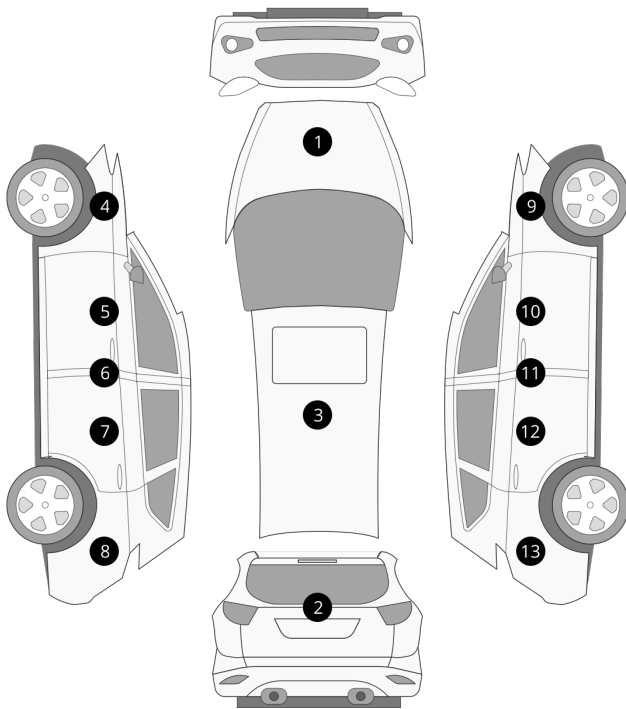


General Information

Date & Time: 13, Oct, 2025 20:59

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	41,366
Registration No.	FAI5361	Chassis No.	PA1B18F34M4156843
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



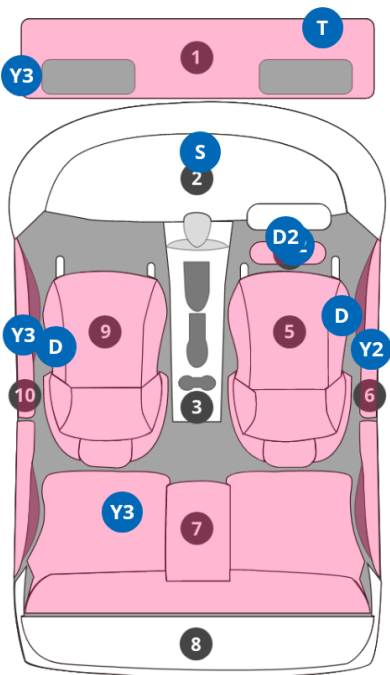
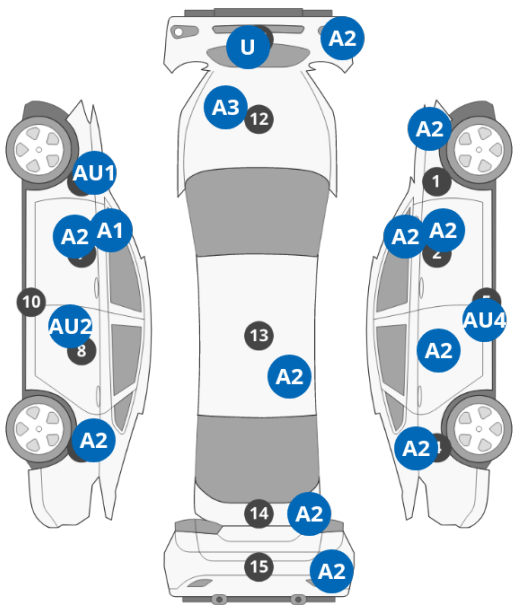
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	189.6	208	167	194
2	Boot Lid	113.0	113	108	118
3	Roof	93.9	95	89	97/95
4	Left Front Fender	92.8	87	99	93
5	Left Front Door	93.0	88	94	97
6	Center Panel Left				
7	Left Rear Door	103.3	118	99	94
8	Left Back Panel	111.0	118	106	109
9	Right Front Fender	95.3	96	100	90
10	Right Front Door	95.6	93	100	94
11	Center Panel Right				
12	Right Rear Door	103.2	103	97	110
13	Right Back Panel	99.3	92	99	107

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Medium / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Worked - Small / (L) Front Seat - Worn - Yes / Ceiling - Cigarette Burns - Burnt, Hole / Ceiling - Grime - Medium / (R) Front Seat - Worn - Yes / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Medium / Overall Interior - Smell - Yes	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Member (Bolted) - Dent - Yes / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Medium / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet, no jack and tools, with spare tire, with LTO plate, possible flooding, scratched and cracked tail light, worn tires