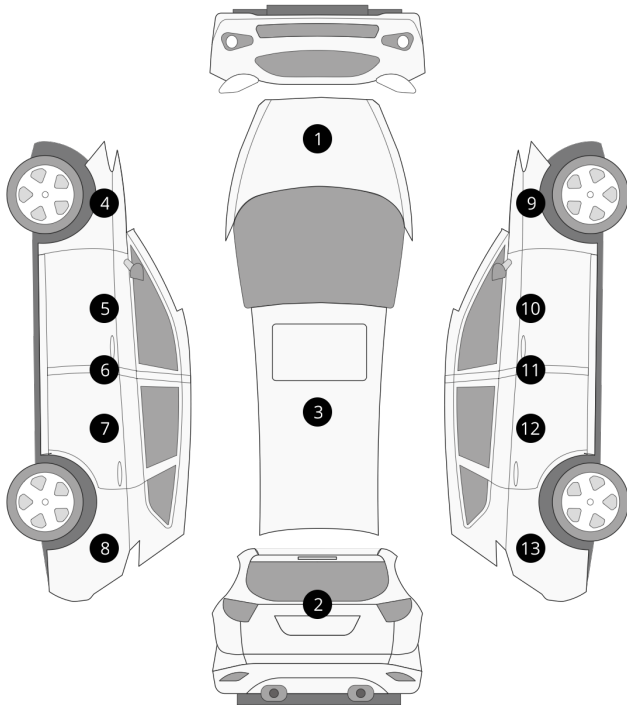


General Information

Date & Time: 17, Feb, 2026 08:52

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	27,881
Registration No.	FAO1671 (NON MOVING)	Chassis No.	PA1B18F36P4202001
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



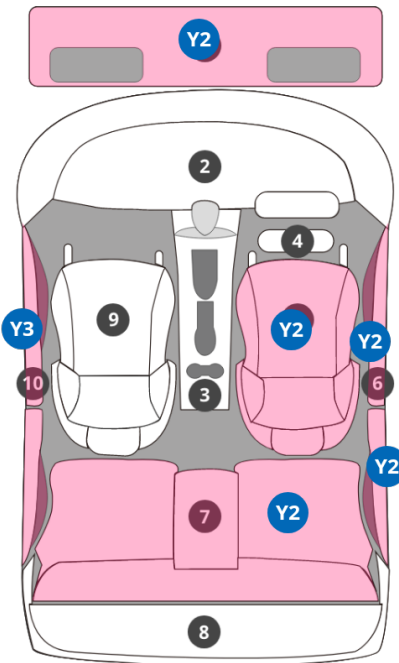
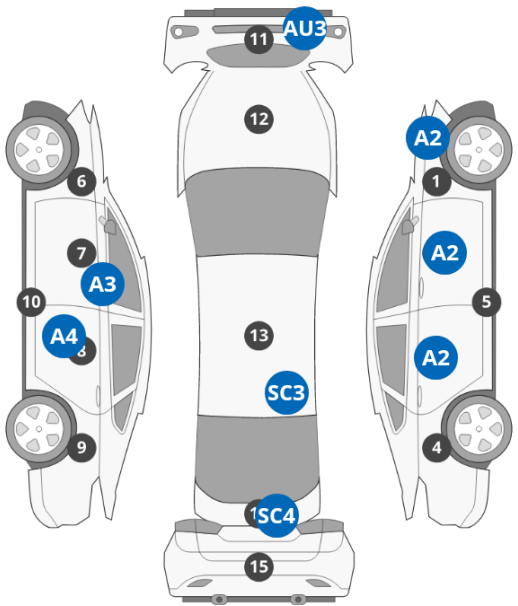
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	91.4	93	94	88
2	Boot Lid	95.0	100	90	95
3	Roof	86.3	90	85	84/86
4	Left Front Fender	100.2	106	95	100
5	Left Front Door	92.2	96	89	93
6	Center Panel Left				
7	Left Rear Door	98.7	107	92	97
8	Left Back Panel	96.5	104	94	92
9	Right Front Fender	89.4	88	93	87
10	Right Front Door	85.1	84	84	88
11	Center Panel Right				
12	Right Rear Door	91.3	81	89	104
13	Right Back Panel	88.4	85	83	97

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is" (FAO1671 (NON MOVING)) and this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Trim - Grime - Small / (R) Rear Trim - Grime - Small / (L) Front Trim - Grime - Medium / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / Ceiling - Grime - Small</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / Trunk Hood, Rear Gate - Rust, Corrosion - Large / (L) Rear Door, Molding - Scratch - Large / (L) Front Door, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / Roof - Rust, Corrosion - Medium</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no spare key. no spare tire. no jack and tools. no warranty booklet. no seat cover</p>