

General Information

Date & Time: 25, Oct, 2025 06:56

Make	Toyota	Model	Innova
YOM	2023	Odo Meter Reading	41,966
Registration No.	FAO6646	Chassis No.	PA2JA8EM1P0124106
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Red Mica Metallic		

Body / Panel Condition



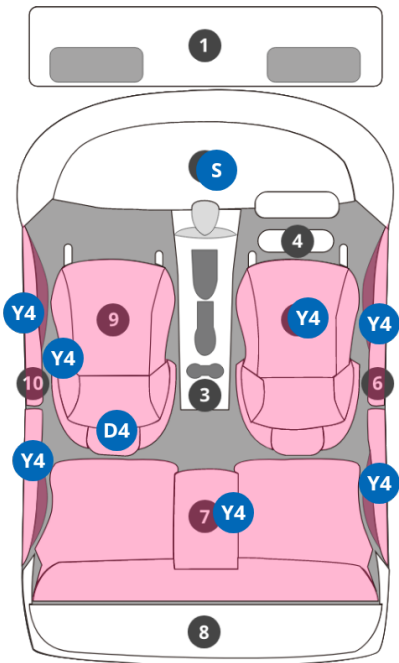
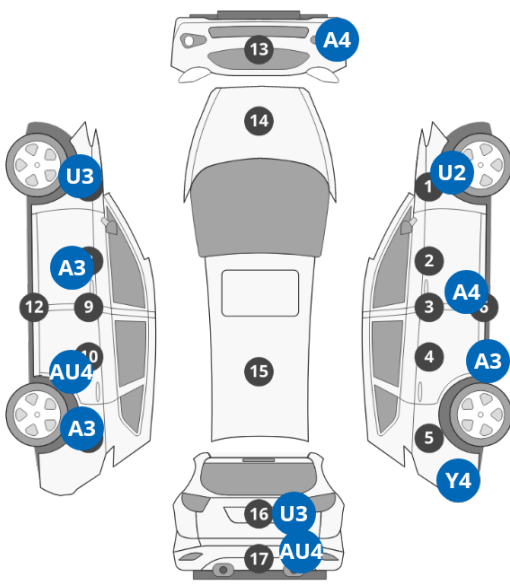
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.0	102	113	109
2	Boot Lid	105.8	109	109	100
3	Roof	104.6	94	112	114/99
4	Left Front Fender	106.0	105	108	105
5	Left Front Door	108.0	111	108	105
6	Center Panel Left				
7	Left Rear Door	110.0	106	116	108
8	Left Back Panel	116.6	119	120	111
9	Right Front Fender	108.3	106	107	112
10	Right Front Door	104.0	101	105	106
11	Center Panel Right				
12	Right Rear Door	105.4	99	107	110
13	Right Back Panel	109.0	111	105	111

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Smell - Yes / (R) Front Trim - Grime - Large / (R) Front Seat - Grime - Large / (R) Rear Trim - Grime - Large / Rear Seat - Grime - Large / (L) Rear Trim - Grime - Large / (L) Front Trim - Grime - Large / (L) Front Seat Head Rest - Worked - Large / (L) Front Seat belt - Grime - Large</p>	<p>Remarks (L) Rear Door, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Dent - Medium / (L) Rear Fender, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Dent - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (R) Rear Fender, Molding - Crack, Gap - Large / (R) Step, In-panel, Side Spoiler - Scratch - Medium / (R) Front Door, Molding - Scratch - Large / (R) Front Fender, Molding - Dent - Small / Front Bumper, Grille, Lamps - Scratch - Large</p>
Frame Evaluation : A	Functional Evaluation : E
<p>Remarks Defects not found</p>	<p>Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Panel, Meter - Issue - Yes / Door Lock - Issue - Yes / Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Power Steering Pump - Leak - Yes / Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>possible flooding/ trunk issue/ non moving vehicle/ check engine light/ no warranty booklet and tools/ no jack/ with spare tire and LTO plate</p>