

General Information

Date & Time: 15, Jan, 2026 10:46

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	43,086
Registration No.	FAO7170	Chassis No.	PA1B18F37P4214903
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



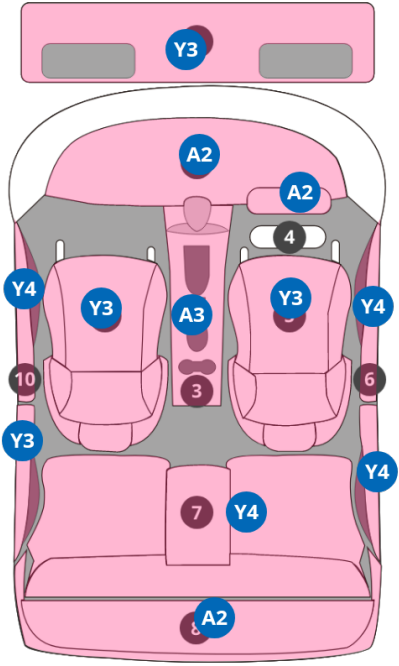
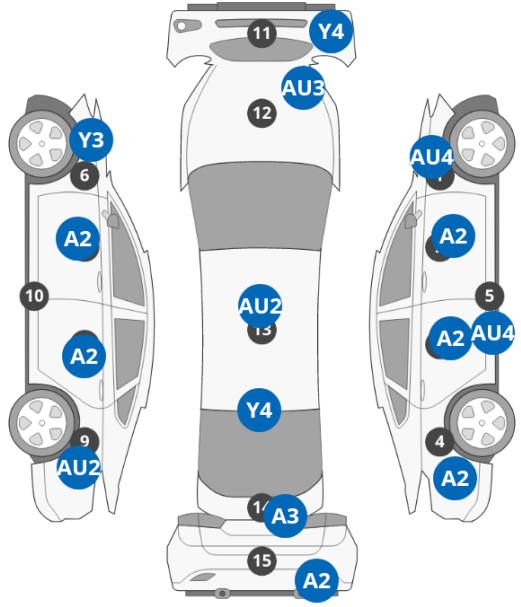
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.6	103	104	116
2	Boot Lid	101.6	98	100	107
3	Roof	94.9	100	100	92/88
4	Left Front Fender	96.5	98	96	95
5	Left Front Door	98.5	99	96	101
6	Center Panel Left				
7	Left Rear Door	94.8	101	90	93
8	Left Back Panel	106.0	120	100	98
9	Right Front Fender	96.0	96	95	97
10	Right Front Door	94.8	103	90	92
11	Center Panel Right				
12	Right Rear Door	98.4	91	95	109
13	Right Back Panel	108.0	102	112	110

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Large / (R) Rear Trim - Grime - Large / Rear Seat - Grime - Large / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Rear Trim - Grime - Medium / (L) Front Trim - Grime - Large / (L) Front Seat - Grime - Medium / Steering Wheel - Worn, Peel, Crack - Small / Ceiling - Grime - Medium / Dashboard - Worn, Scratch, Cut, Crack - Small / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Medium</p>	<p>Remarks (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Large / Bonnet, Headlight - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Crack, Gap - Large / Roof - Scratch & Dent - Small / (L) Front Fender, Molding - Crack, Gap - Medium / (L) Front Door, Molding - Scratch - Small / Rear Windshield - Damaged - Large</p>
Frame Evaluation : B	Functional Evaluation : C
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Warning Lamps - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Seat Belts - Issue - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate/With spare tire/with 1 spare key/No reverse camera/No warranty booklet/right side headlight damaged/possible flooding/No jack and tools/interior dirty/rear windshield not original/with seat cover</p>