

General Information

Date & Time: 15, Jan, 2026 10:43

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	20,142
Registration No.	FAO7867	Chassis No.	PA1B18F33P4212033
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



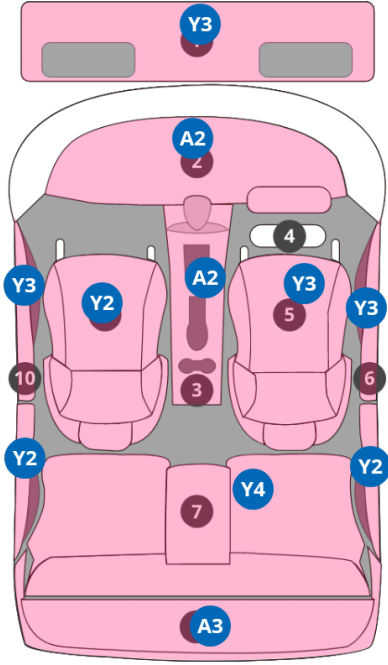
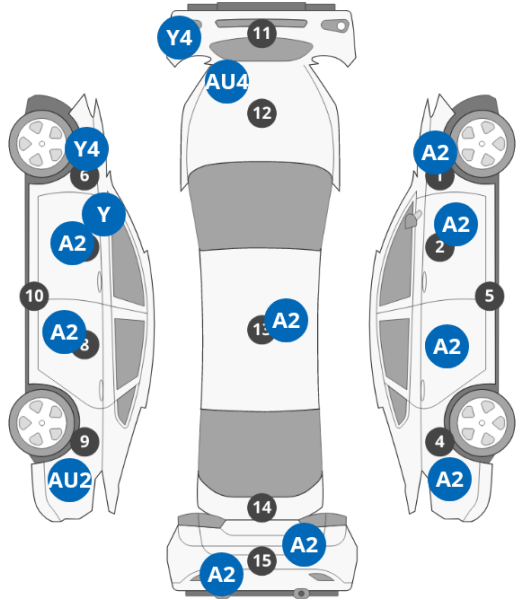
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.3	105	101	122
2	Boot Lid	107.0	102	111	108
3	Roof	95.7	92	95	91/105
4	Left Front Fender	92.3	93	93	92
5	Left Front Door	87.7	89	88	86
6	Center Panel Left				
7	Left Rear Door	91.3	92	92	90
8	Left Back Panel	104.4	102	96	115
9	Right Front Fender	90.8	94	88	90
10	Right Front Door	88.6	88	87	91
11	Center Panel Right				
12	Right Rear Door	94.6	89	90	105
13	Right Back Panel	95.2	88	102	96

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (L) Front Seat - Grime - Small / (L) Front Trim - Grime - Medium / (L) Rear Trim - Grime - Small / Rear Seat - Grime - Large / (R) Rear Trim - Grime - Small / (R) Front Seat - Grime - Medium / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Medium / Dashboard - Worn, Scratch, Cut, Crack - Small / (R) Front Trim - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Medium	Remarks (L) Mirror - Crack - Damaged / (L) Front Fender, Molding - Crack, Gap - Large / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / Roof - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Small
Frame Evaluation : C	Functional Evaluation : D
Remarks Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Warning Lamps - Issue - Yes / Shift Shock - Function - Weak / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with spare tire/No spare key/No jack and tools/No reverse camera/No warranty booklet /left side fender damaged/left side mirror damage/left side headlight damage/front bumper damage/left side front door issue/cross member cover missing/No seat cover/interior dirty