

General Information

Date & Time: 16, Oct, 2025 18:11

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	28,274
Registration No.	FAP6771	Chassis No.	PA1B18F35P4221834
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



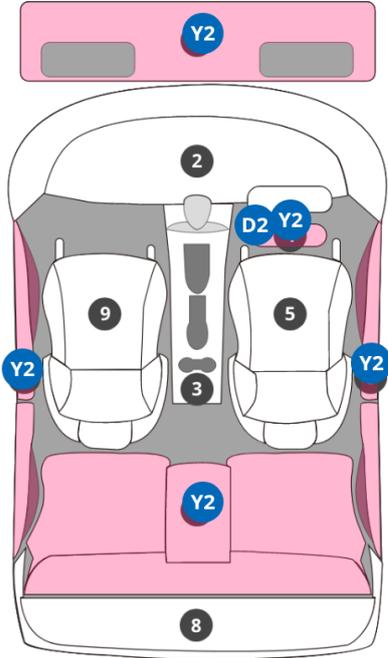
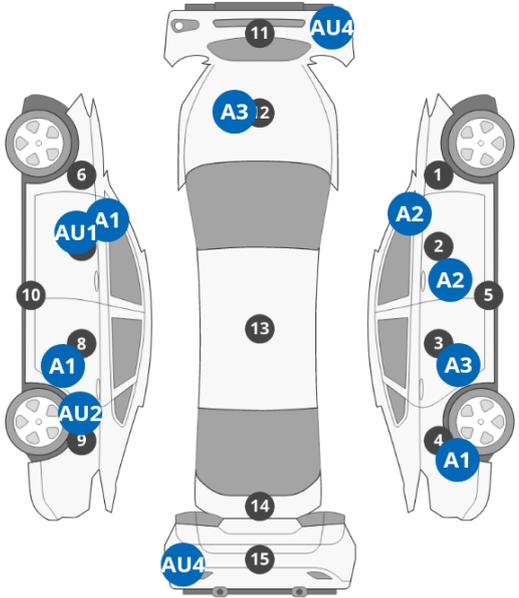
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.9	106	98	108
2	Boot Lid	112.6	109	119	110
3	Roof	98.0	93	95	104/100
4	Left Front Fender	92.7	95	91	92
5	Left Front Door	99.8	100	96	104
6	Center Panel Left				
7	Left Rear Door	99.7	113	95	91
8	Left Back Panel	101.0	106	96	101
9	Right Front Fender	98.1	95	102	98
10	Right Front Door	102.3	109	98	100
11	Center Panel Right				
12	Right Rear Door	107.6	109	100	114
13	Right Back Panel	112.1	77	142	118

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Small / (R) Front Trim - Grime - Small / Rear Seat - Grime - Small / Mat Other - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small</p>	<p>Remarks Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Medium / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Crack left taillight. Without warranty booklet,jack,tools and seat cover. With spare tire. 1 key. With LTO plate.</p>