

General Information

Date & Time: 17, Oct, 2025 16:51

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	9,863
Registration No.	FAQ8985	Chassis No.	PA1B18F36R4264162
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



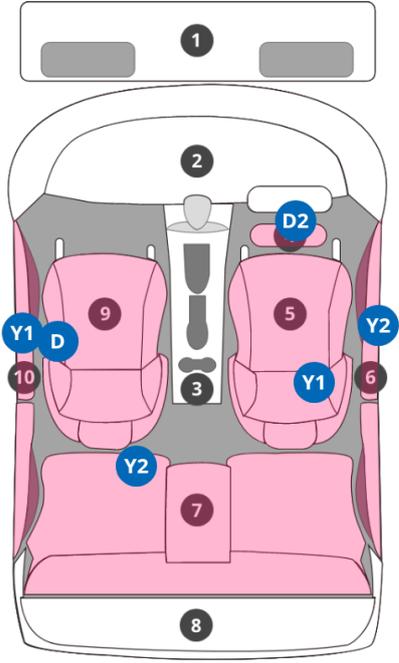
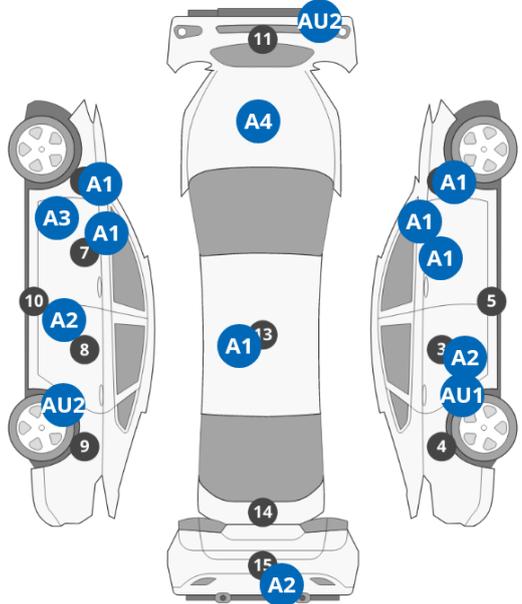
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	120.0	116	120	124
2	Boot Lid	124.0	131	118	123
3	Roof	115.0	118	115	108/119
4	Left Front Fender	105.3	106	102	108
5	Left Front Door	109.0	107	106	114
6	Center Panel Left				
7	Left Rear Door	110.6	116	115	101
8	Left Back Panel	113.6	111	118	112
9	Right Front Fender	103.7	99	107	105
10	Right Front Door	105.3	112	104	100
11	Center Panel Right				
12	Right Rear Door	107.3	100	105	117
13	Right Back Panel	110.0	110	105	115

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Worn - Yes / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Small / Rear Seat - Grime - Small / (R) Front Seat - Grime - Minimal / (L) Front Floor Mat - Worked - Small</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Large / Roof - Scratch - Minimal / (R) Mirror - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with warranty booklet, with jack, no tools, with spare tire, no LTO plate, scratches on tail light, trunk floorbed/floor mat cover missing, headlight and hazard/turn signal light issue, replaced head unit</p>