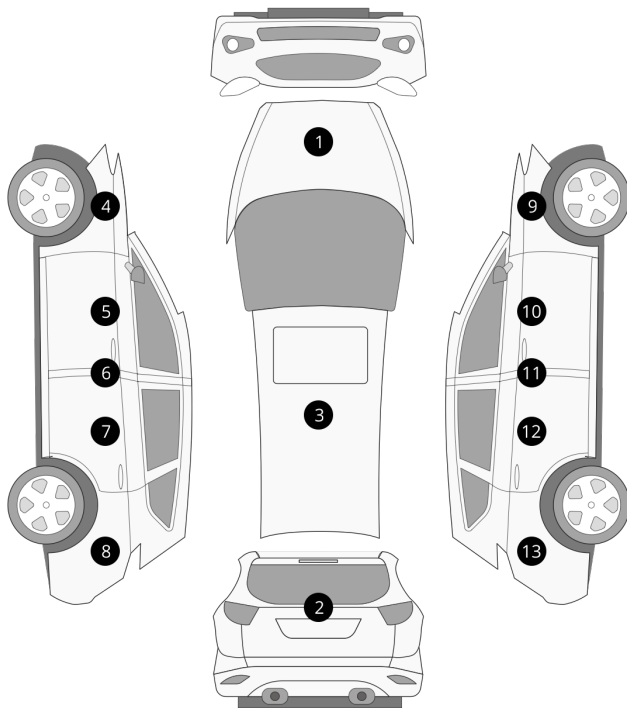


General Information

Date & Time: 23, Oct, 2025 19:00

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	34,781
Registration No.	FAR5412	Chassis No.	PA1B18F35R4251645
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



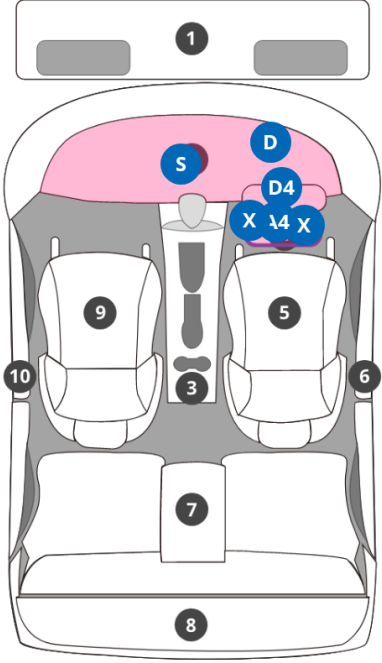
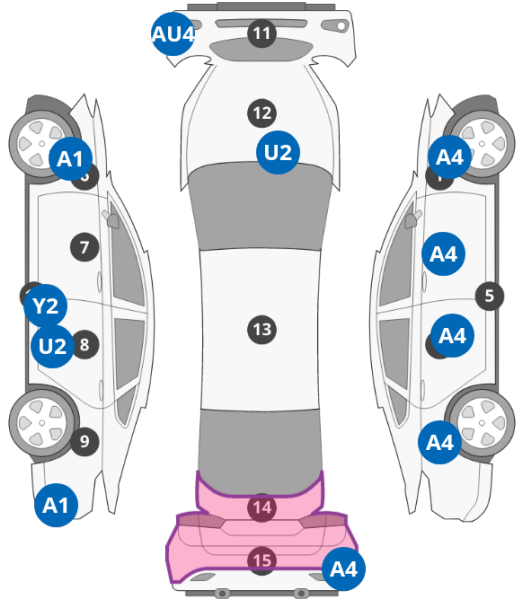
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.3	113	114	107
2	Boot Lid	469.0	196	999	212
3	Roof	109.4	114	111	97/116
4	Left Front Fender	108.0	100	106	118
5	Left Front Door	102.0	101	101	104
6	Center Panel Left				
7	Left Rear Door	108.0	111	104	109
8	Left Back Panel	109.1	117	111	99
9	Right Front Fender	113.0	109	109	121
10	Right Front Door	112.6	111	110	117
11	Center Panel Right				
12	Right Rear Door	118.3	105	117	133
13	Right Back Panel	113.0	113	106	120

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Mat Other - Missing - Yes / Glove Box - Loose, Deformed - Large / (R) Front Floor Mat - Cut, Crack - Large / (L) Front Floor Mat - Missing - Yes / Dashboard - Traces of Adhesive Tape - Yes / Overall Interior - Smell - Yes	Remarks Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Rear Door, Molding - Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Large / (L) Front Door, Molding - Crack, Gap - Small / (R) Rear Fender, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch - Large / (R) Front Door, Molding - Scratch - Large / (R) Front Fender, Molding - Scratch - Large / Trunk Hood, Rear Gate - Repair mark - Yes / (L) Rear Fender, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Dent - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet and LTO plate/ no tools and jack/ no spare tire