

General Information

Date & Time: 13, Jan, 2026 19:23

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	4,029
Registration No.	FAR7058	Chassis No.	PA1B18F30R4255554
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



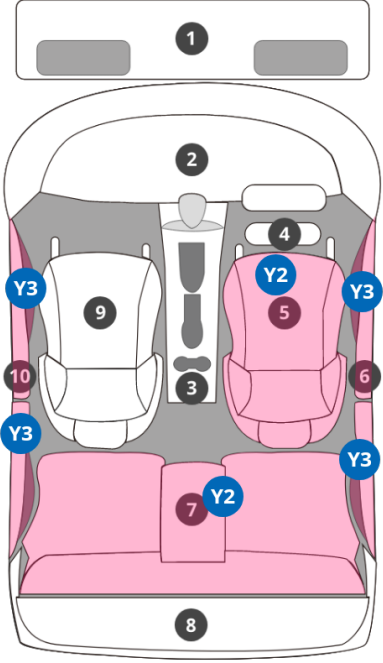
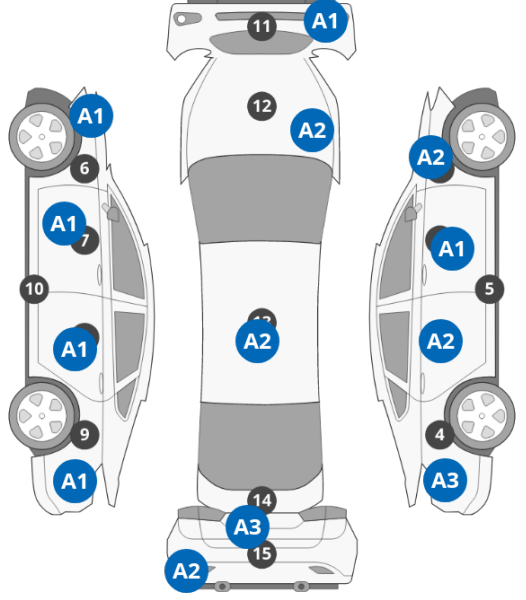
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.0	121	91	106
2	Boot Lid	101.5	96	100	109
3	Roof	92.6	98	94	86/93
4	Left Front Fender	94.8	93	96	96
5	Left Front Door	94.7	95	96	94
6	Center Panel Left				
7	Left Rear Door	98.4	100	100	95
8	Left Back Panel	102.2	108	103	96
9	Right Front Fender	96.5	99	98	93
10	Right Front Door	99.9	92	112	96
11	Center Panel Right				
12	Right Rear Door	97.0	91	100	100
13	Right Back Panel	99.6	98	100	101

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Small / (R) Rear Trim - Grime - Medium / (R) Front Seat - Grime - Small / (R) Front Trim - Grime - Medium / (L) Front Trim - Grime - Medium / (L) Rear Trim - Grime - Medium</p>	<p>Remarks Trunk Hood, Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Medium / Roof - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes</p>

<p>Inspector Notes</p>
<p>No LTO plate/with spare tire/with 1 spare key/with reverse camera/No warranty booklets/ park light issue/No jack and tools</p>