

General Information

Date & Time: 17, Oct, 2025 16:52

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	26,194
Registration No.	FAR9447	Chassis No.	PA1B18F31R4259385
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



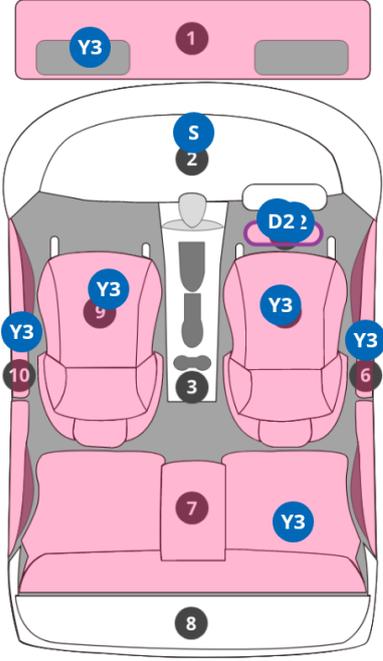
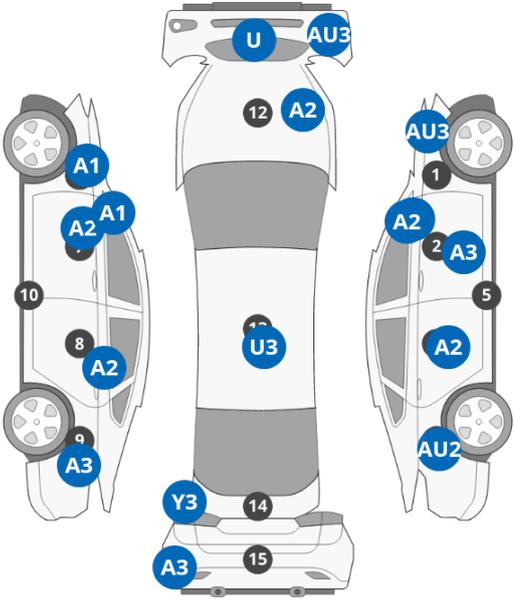
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.0	106	101	105
2	Boot Lid	106.0	101	108	109
3	Roof	97.5	103	98	93/97
4	Left Front Fender	92.9	90	90	98
5	Left Front Door	99.4	94	99	105
6	Center Panel Left				
7	Left Rear Door	101.1	109	99	96
8	Left Back Panel	111.7	120	118	97
9	Right Front Fender	97.8	99	99	95
10	Right Front Door	98.3	102	98	95
11	Center Panel Right				
12	Right Rear Door	100.1	98	100	102
13	Right Back Panel	103.2	102	99	109

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Smell - Yes / (L) Front Seat - Grime - Medium / (R) Front Seat - Grime - Medium / (L) Front Trim - Grime - Medium / Rear Seat - Grime - Medium / (R) Front Trim - Grime - Medium / Mat Other - Worked - Small / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Medium</p>	<p>Remarks Member (Bolted) - Dent - Yes / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Mirror - Stuck - Yes / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Crack, Gap - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Small / Roof - Dent - Medium / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet, with jack, no tools, with spare tire, no LTO plate, scratches on tail light, possible flooding, mould on interior, park light issue</p>