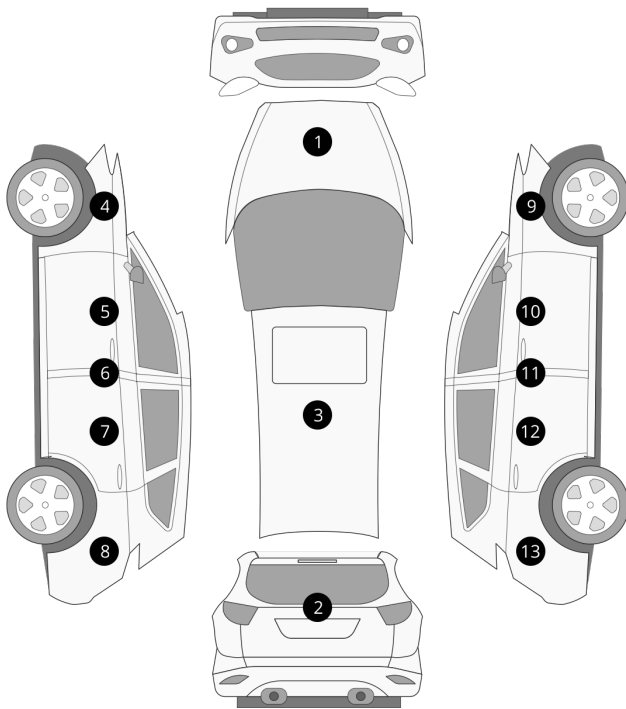


General Information

Date & Time: 13, Oct, 2025 19:17

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	14,491
Registration No.	FAS2107	Chassis No.	PA1B18F30R4272354
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



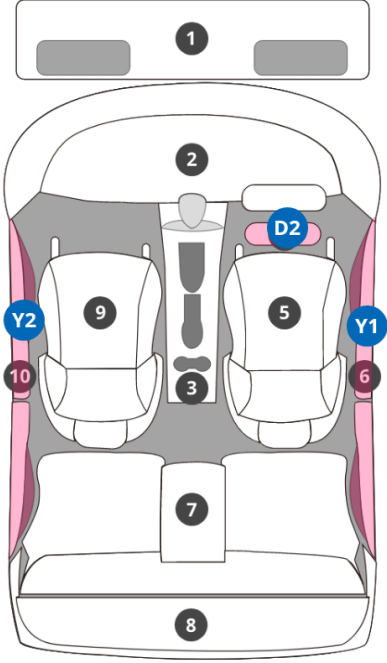
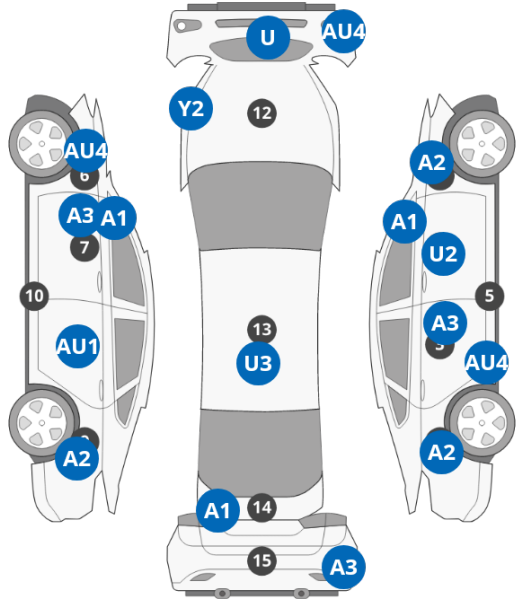
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	101.4	102	97	105
2	Boot Lid	108.3	114	105	106
3	Roof	93.9	96	94	89/97
4	Left Front Fender	94.7	90	96	98
5	Left Front Door	92.7	86	87	105
6	Center Panel Left				
7	Left Rear Door	105.5	118	101	98
8	Left Back Panel	105.3	108	112	96
9	Right Front Fender	99.8	98	102	100
10	Right Front Door	97.3	107	93	93
11	Center Panel Right				
12	Right Rear Door	104.5	100	95	119
13	Right Back Panel	105.6	107	101	109

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / (R) Front Trim - Grime - Minimal	Remarks Bonnet, Headlight - Crack, Gap - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Member (Bolted) - Dent - Yes / (L) Front Fender, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch - Medium / Roof - Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Dent - Small / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (L) Mirror - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes

Inspector Notes
with warranty booklet, no jack and tools, no spare tire, with LTO plate, scratches on tail light