

General Information

Date & Time: 13, Oct, 2025 19:05

Make	Toyota	Model	Avanza
YOM	2025	Odo Meter Reading	13,207
Registration No.	FAS5009	Chassis No.	MHFAA1BY5R0035919
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Green		

Body / Panel Condition



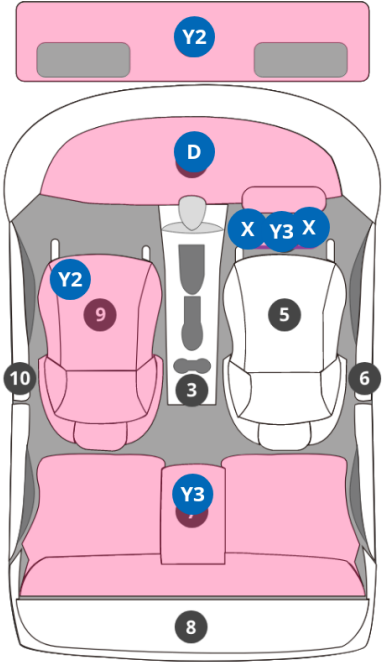
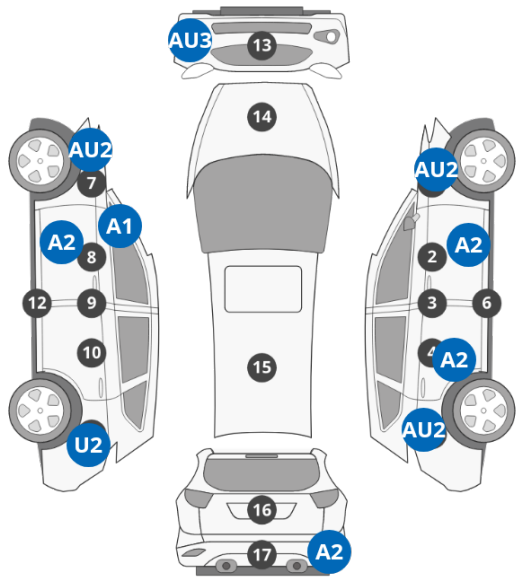
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.7	102	99	110
2	Boot Lid	87.8	86	92	86
3	Roof	112.7	128	120	104/99
4	Left Front Fender	95.7	94	92	101
5	Left Front Door	108.6	100	108	118
6	Center Panel Left				
7	Left Rear Door	100.0	101	99	100
8	Left Back Panel	108.8	119	108	100
9	Right Front Fender	96.7	101	99	91
10	Right Front Door	104.3	109	104	100
11	Center Panel Right				
12	Right Rear Door	103.3	104	97	109
13	Right Back Panel	106.5	100	100	120

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / (R) Front Floor Mat - Missing - Yes / Dashboard - Traces of Adhesive Tape - Yes / Rear Seat - Grime - Medium / (L) Front Seat - Grime - Small / (L) Front Floor Mat - Missing - Yes / Mat Other - Grime - Medium	Remarks (R) Front Fender, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Dent - Small / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes

Inspector Notes

With warranty booklet and spare tire. Without jack, tools and seat cover. 2 keys. With LTO plate.