

General Information

Date & Time: 15, Jan, 2026 13:29

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	8,401
Registration No.	GBC3221	Chassis No.	PA1B18F39P4235476
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



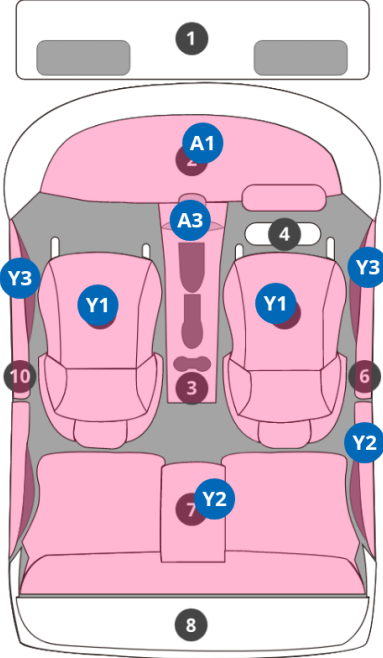
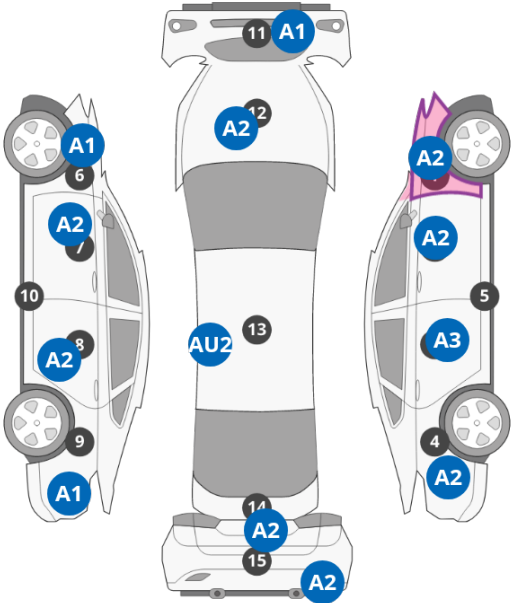
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.3	103	96	108
2	Boot Lid	96.4	91	94	104
3	Roof	94.3	101	98	84/95
4	Left Front Fender	90.6	89	91	92
5	Left Front Door	91.9	93	92	90
6	Center Panel Left				
7	Left Rear Door	95.5	100	91	95
8	Left Back Panel	100.8	115	94	94
9	Right Front Fender	365.0	163	232	700
10	Right Front Door	94.3	96	91	96
11	Center Panel Right				
12	Right Rear Door	95.3	104	86	96
13	Right Back Panel	97.6	86	94	113

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Small / (L) Front Trim - Grime - Medium / (R) Front Seat - Grime - Minimal / (L) Front Seat - Grime - Minimal / (R) Rear Trim - Grime - Small / (R) Front Trim - Grime - Medium / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Medium / Dashboard - Worn, Scratch, Cut, Crack - Minimal</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Yes / Roof - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/No spare key/No reverse camera/No warranty booklet/with jack and incomplete tools /with seat cover</p>