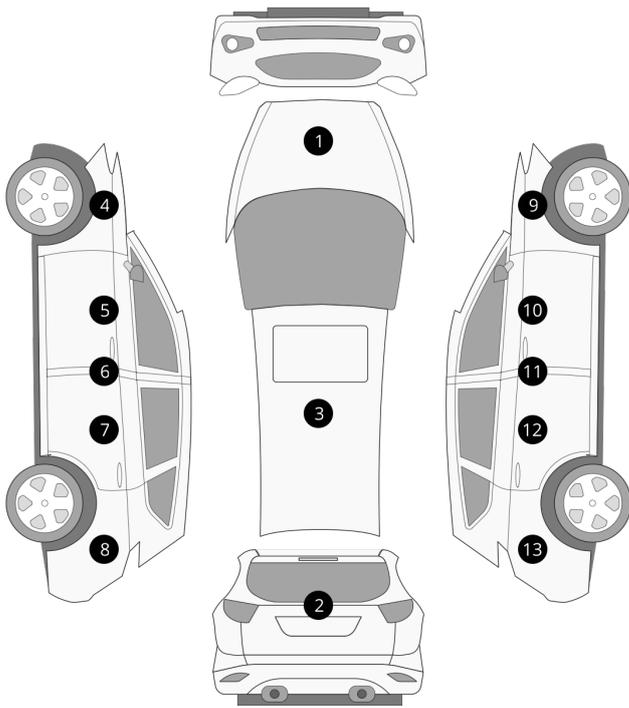


General Information

Date & Time: 17, Oct, 2025 16:47

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	5,548
Registration No.	GBE3909	Chassis No.	PA1B18F34R4253693
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



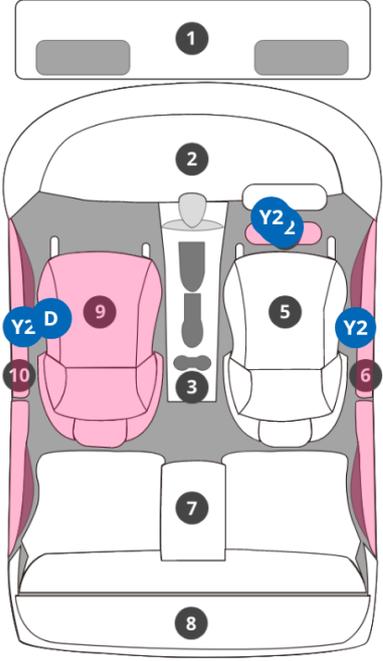
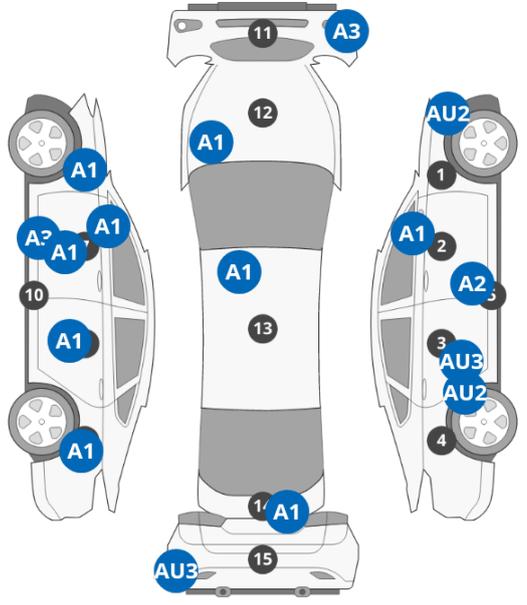
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	119.0	115	118	124
2	Boot Lid	121.3	127	110	127
3	Roof	113.5	124	105	114/111
4	Left Front Fender	111.0	108	112	113
5	Left Front Door	104.0	104	105	103
6	Center Panel Left				
7	Left Rear Door	113.3	114	118	108
8	Left Back Panel	118.3	126	111	118
9	Right Front Fender	105.6	105	105	107
10	Right Front Door	108.0	114	105	105
11	Center Panel Right				
12	Right Rear Door	117.0	120	109	122
13	Right Back Panel	105.6	104	104	109

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Grime - Small / (L) Front Seat - Worn - Yes / Mat Other - Grime - Small</p>	<p>Remarks (R) Front Fender, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Medium / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with warranty booklet, with jack and tools, with spare tire, no LTO plate, scratches on tail light</p>