

General Information

Date & Time: 15, Jan, 2026 08:22

Make	Toyota	Model	Vios
YOM	2020	Odo Meter Reading	30,041
Registration No.	GAO4685	Chassis No.	PA1B18F30L4110330
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



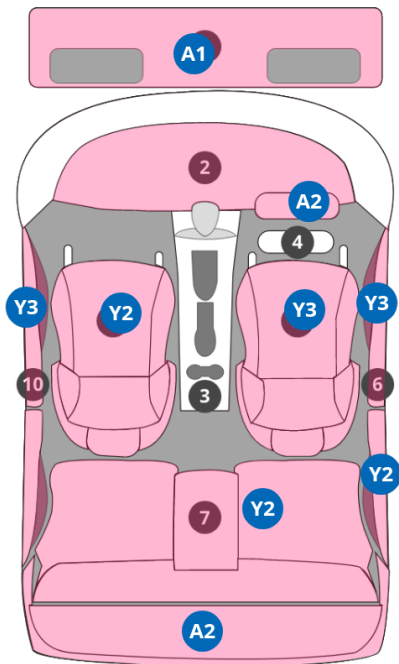
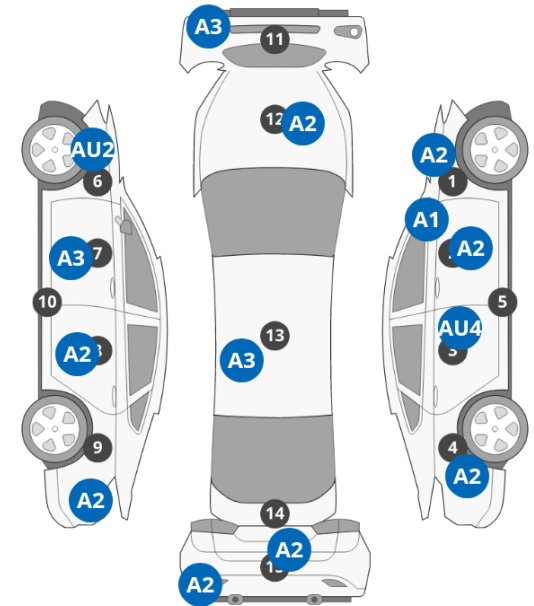
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	101.7	110	95	100
2	Boot Lid	91.0	86	88	99
3	Roof	82.3	92	79	77/82
4	Left Front Fender	82.3	82	82	84
5	Left Front Door	84.4	84	84	86
6	Center Panel Left				
7	Left Rear Door	88.3	95	81	88
8	Left Back Panel	102.6	119	90	99
9	Right Front Fender	88.6	94	88	84
10	Right Front Door	86.3	81	81	96
11	Center Panel Right				
12	Right Rear Door	112.8	82	91	166
13	Right Back Panel	84.7	80	82	92

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Trunk Room - Worn, Scratch, Cut, Crack - Small / Rear Seat - Grime - Small / (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Medium / (R) Rear Trim - Grime - Small / (L) Front Seat - Grime - Small / Steering Wheel - Worn, Peel, Crack - Small / (L) Front Trim - Grime - Medium / Ceiling - Cut, Crack - Minimal</p>	<p>Remarks (R) Rear Door - Repair Traces - Yes / (L) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / Roof - Scratch - Medium</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/No spare key/No spare tire No reverse camera/No warranty booklet/with jack and incomplete tools/No fog light/interior dirty/possible flooding/with seat cover</p>