

## General Information

Date & Time: 17, Feb, 2026 08:50

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2021	<b>Odo Meter Reading</b>	59,434
<b>Registration No.</b>	KAG6381 - Non Moving	<b>Chassis No.</b>	PA1B18F34M4149066
<b>CC</b>	1.3	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Red		

## Body / Panel Condition



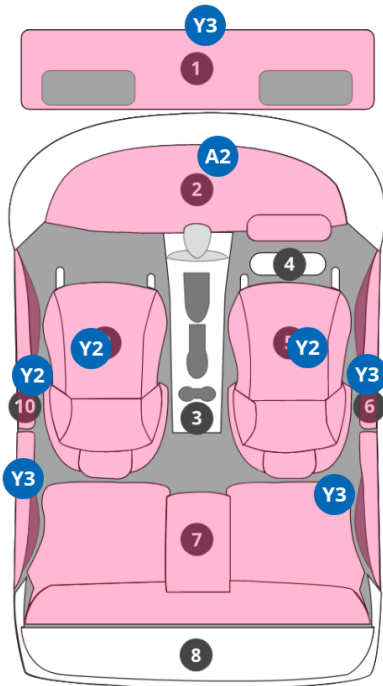
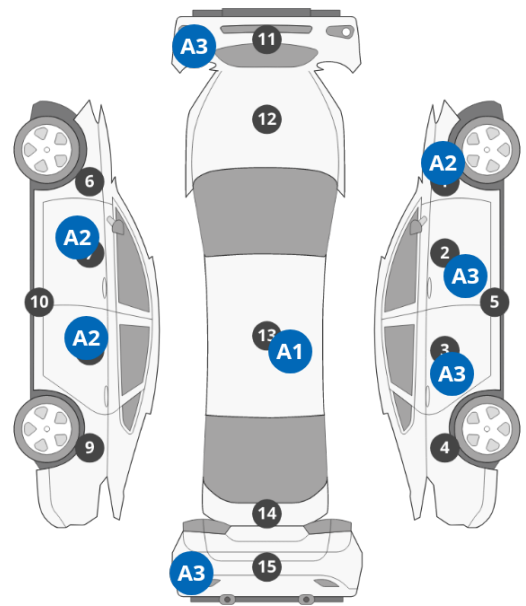
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.6	128	104	121
2	Boot Lid	135.6	132	151	124
3	Roof	102.1	120	93	96/100
4	Left Front Fender	140.3	163	134	124
5	Left Front Door	108.4	110	97	118
6	Center Panel Left				
7	Left Rear Door	96.6	102	94	94
8	Left Back Panel	104.6	110	104	100
9	Right Front Fender	91.2	93	91	90
10	Right Front Door	96.8	101	97	93
11	Center Panel Right				
12	Right Rear Door	125.3	93	129	154
13	Right Back Panel	99.4	96	100	102

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Rear Seat - Grime - Medium / Ceiling - Grime - Medium / (R) Front Trim - Grime - Medium / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Small / (L) Front Trim - Grime - Small / (L) Rear Trim - Grime - Medium</p>	<p><b>Remarks</b> (R) Front Door - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Roof - Scratch - Minimal</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Air Conditioner - Function - Weak / Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Parking Brake - Function - Weak / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>TOWED UNIT. not starting/cranking. Functional (not inspected). with spare tire.no spare key. no seat cover. no warranty booklet. modified air intake. possible flooded. modified steering wheel.</p>