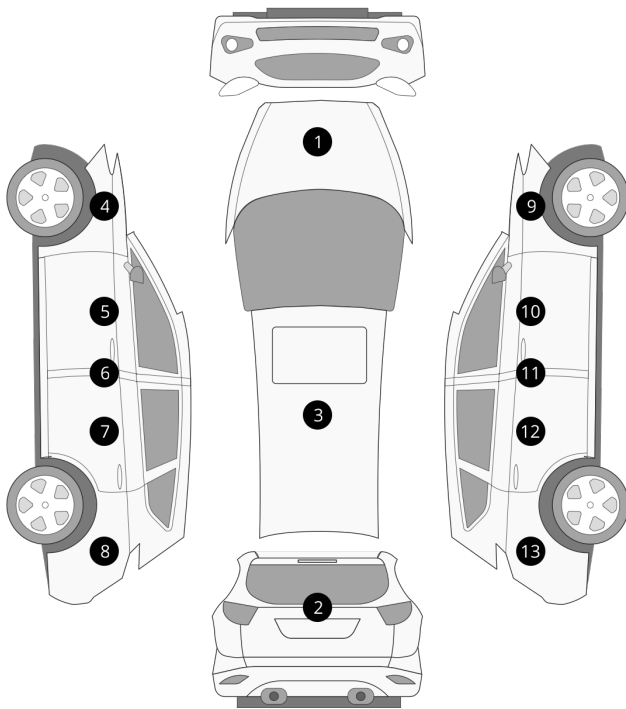


General Information

Date & Time: 21, Nov, 2025 14:05

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	8,833
Registration No.	GBF3848	Chassis No.	PA1B18F31R4261167
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



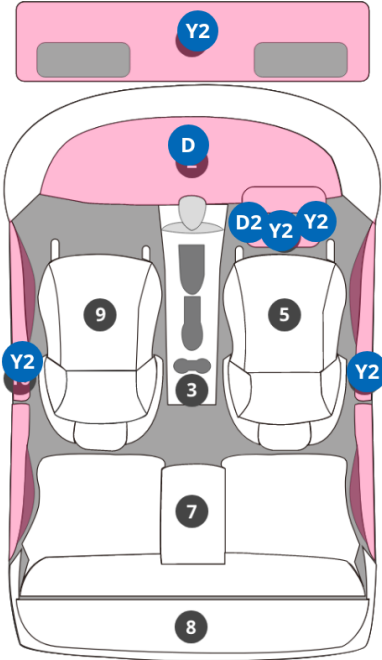
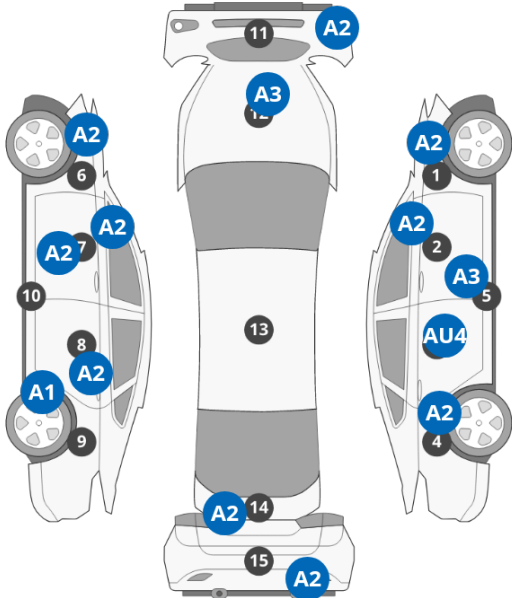
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.3	121	103	113
2	Boot Lid	104.6	105	101	108
3	Roof	96.9	99	97	91/102
4	Left Front Fender	96.2	99	94	95
5	Left Front Door	95.6	95	96	96
6	Center Panel Left				
7	Left Rear Door	102.2	109	102	96
8	Left Back Panel	105.6	106	107	104
9	Right Front Fender	94.9	94	95	96
10	Right Front Door	100.8	99	104	100
11	Center Panel Right				
12	Right Rear Door	103.0	102	106	101
13	Right Back Panel	107.4	109	96	117

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation :	B	Exterior Evaluation :	D
			
a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain		A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap	
Remarks Ceiling - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Mat Other - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small		Remarks (R) Mirror - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Fender, Molding - Scratch - Small	
Frame Evaluation :	A	Functional Evaluation :	B
Remarks Defects not found		Remarks Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist	

Inspector Notes

With warranty booklet, spare tire, jack, and seat cover. Without tools. 1 key. With LTO plate.