

General Information

Date & Time: 10, Nov, 2025 17:40

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	21,734
Registration No.	BE336A	Chassis No.	PA1B18F33P4237286
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



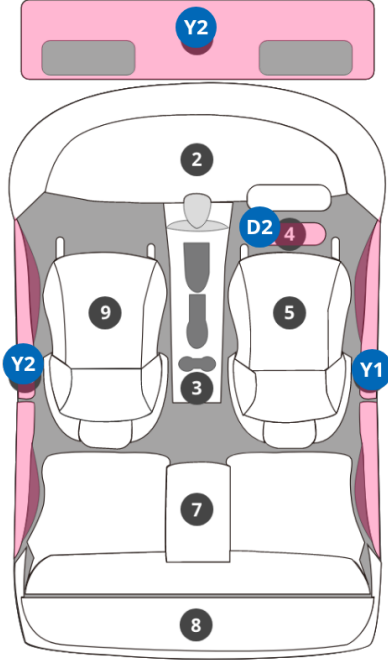
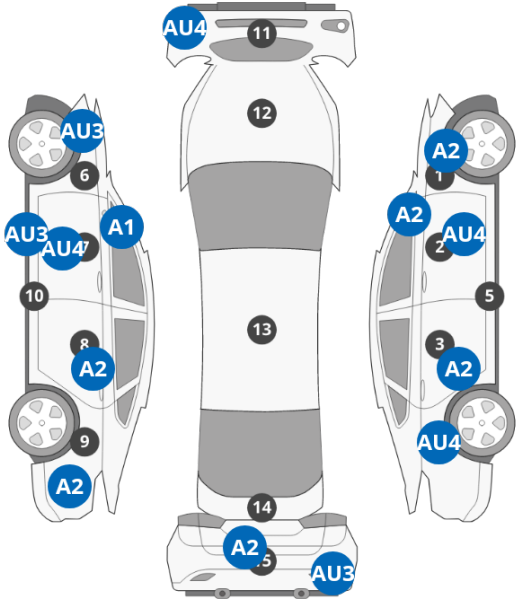
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.2	107	100	103
2	Boot Lid	95.8	95	95	99
3	Roof	98.8	103	100	94/99
4	Left Front Fender	91.0	95	88	90
5	Left Front Door	95.9	98	92	99
6	Center Panel Left				
7	Left Rear Door	97.7	105	100	88
8	Left Back Panel	101.8	104	102	100
9	Right Front Fender	100.1	105	100	96
10	Right Front Door	99.5	106	99	94
11	Center Panel Right				
12	Right Rear Door	102.2	93	100	114
13	Right Back Panel	108.3	105	103	117

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Small</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Large / (R) Mirror - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (L) Front Fender, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Mirror - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Without warranty booklet and tools. With spare tire,jack and seat cover. 1 key. No LTO plate.</p>