

General Information

Date & Time: 14, Nov, 2025 14:53

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	28,911
Registration No.	DBO8480	Chassis No.	PA1B18F31R4258172
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



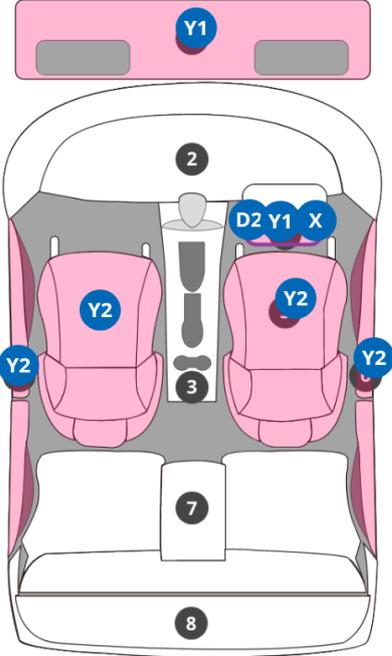
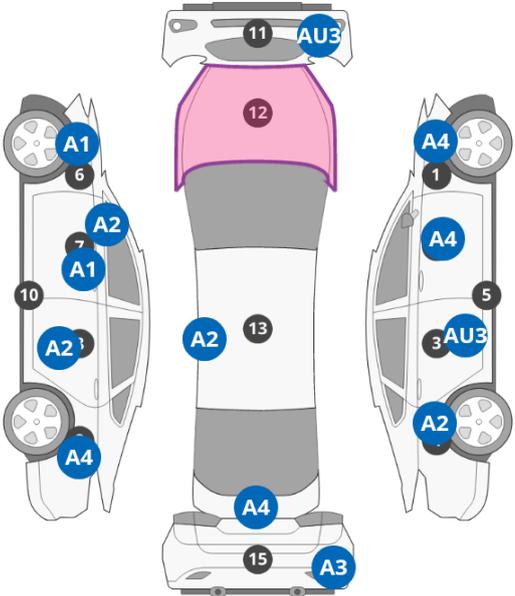
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	175.0	190	176	159
2	Boot Lid	103.3	106	96	108
3	Roof	97.8	99	104	94/95
4	Left Front Fender	97.1	100	95	97
5	Left Front Door	98.8	104	96	96
6	Center Panel Left				
7	Left Rear Door	112.0	115	119	102
8	Left Back Panel	166.0	157	174	167
9	Right Front Fender	98.3	95	100	100
10	Right Front Door	98.5	98	95	103
11	Center Panel Right				
12	Right Rear Door	102.2	97	102	108
13	Right Back Panel	101.9	101	100	105

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Grime - Small / (L) Front Floor Mat - Worked - Small / (L) Front Trim - Grime - Small / Ceiling - Grime - Minimal / Mat Other - Grime - Minimal / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Small / (R) Front Floor Mat - Missing - Yes</p>	<p>Remarks Bonnet - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (L) Rear Fender, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Repair mark - Yes / (R) Front Fender, Molding - Scratch - Large / (R) Front Door, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch - Medium / Roof - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Missing foglamps. Crack left headlight and right taillight. Trunk floor missing. Front Toyota emblem mssing. Toe hook cover missing. Without warranty booklet,spare tire,jack,tools and seat cover. 1 key. With LTO plate.</p>