

General Information

Date & Time: 27, Jan, 2026 18:11

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	42,091
Registration No.	GAW7390	Chassis No.	PA1B18F34N4172154
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



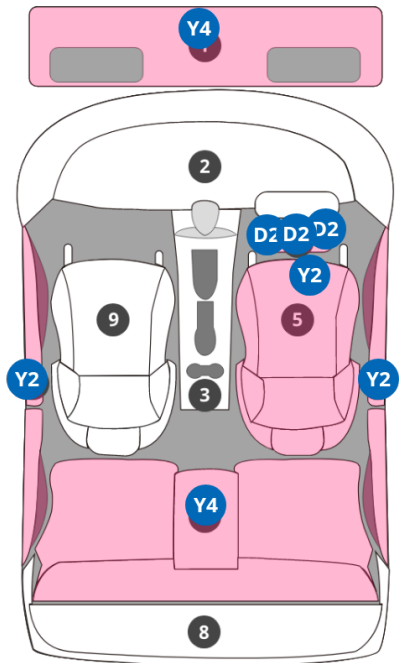
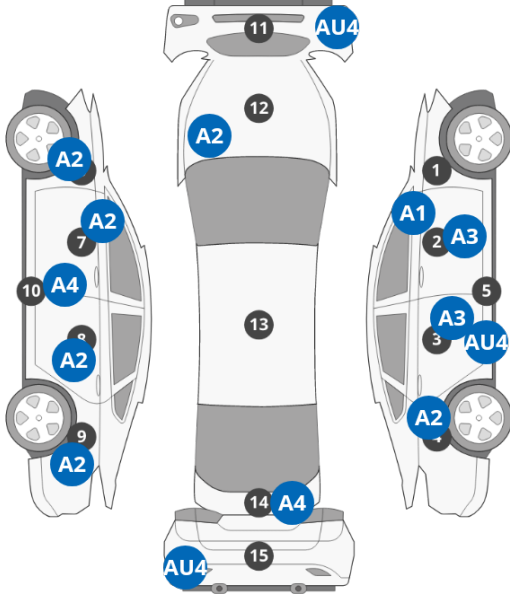
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.6	113	117	114
2	Boot Lid	105.0	104	105	106
3	Roof	93.7	103	97	87/88
4	Left Front Fender	93.6	97	92	92
5	Left Front Door	107.6	110	108	105
6	Center Panel Left				
7	Left Rear Door	110.0	111	111	108
8	Left Back Panel	111.3	114	112	108
9	Right Front Fender	99.2	104	98	96
10	Right Front Door	101.0	101	99	103
11	Center Panel Right				
12	Right Rear Door	106.6	100	111	109
13	Right Back Panel	102.9	105	100	104

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Small / Ceiling - Grime - Large / Rear Seat - Grime - Large / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Worked - Small / Mat Other - Worked - Small</p>	<p>Remarks Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Large / (R) Rear Fender, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : C
<p>Remarks Defects not found</p>	<p>Remarks Power Steering - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>Possible flooding. Without warranty booklet and tools. Incomplete seat cover. With spare tire and jack. 2 keys. No LTO plate.</p>