

General Information

Date & Time: 24, Nov, 2025 15:55

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	5,346
Registration No.	GBC8127	Chassis No.	PA1B18F31R4246023
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



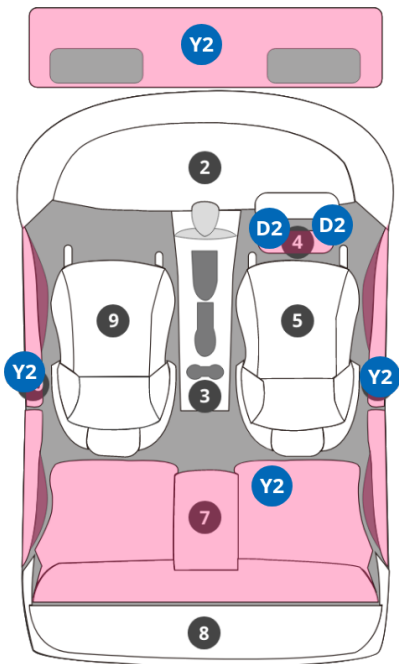
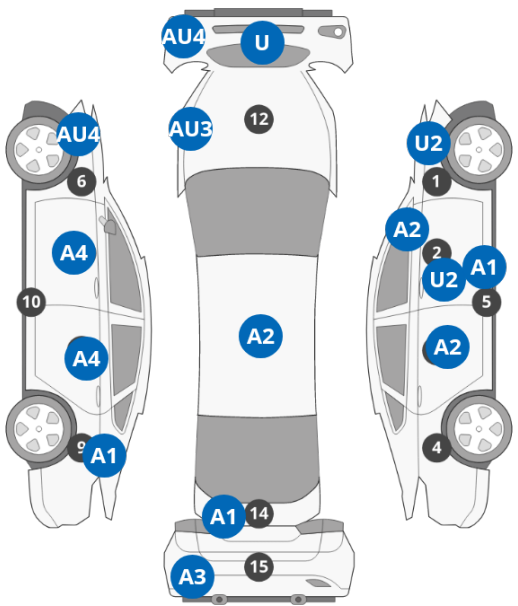
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.6	114	112	109
2	Boot Lid	103.6	100	103	108
3	Roof	97.4	96	106	92/95
4	Left Front Fender	96.0	98	96	95
5	Left Front Door	99.2	97	107	94
6	Center Panel Left				
7	Left Rear Door	104.5	110	106	98
8	Left Back Panel	107.3	119	100	103
9	Right Front Fender	99.4	102	99	97
10	Right Front Door	104.2	104	99	110
11	Center Panel Right				
12	Right Rear Door	110.0	106	115	109
13	Right Back Panel	108.0	107	106	111

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Small / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Small / Rear Seat - Grime - Small / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Worked - Small</p>	<p>Remarks Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch & Dent - Large / Bonnet, Headlight - Scratch & Dent - Medium / (R) Front Fender, Molding - Dent - Small / (R) Mirror - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Door, Molding - Scratch - Large / (L) Rear Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Large / Roof - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / Member (Bolted) - Dent - Yes</p>
Frame Evaluation : B	Functional Evaluation : C
<p>Remarks Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Power Steering - Issue - Yes / Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Damaged front left bumper, front left fender and bonnet. Crack headlight. Low Battery. With warranty booklet, spare tire and leather seat cover. Without jack and tools. 1 key. No LTO plate.</p>