

General Information

Date & Time: 10, Nov, 2025 17:42

Make	Suzuki	Model	XL7
YOM	2024	Odo Meter Reading	15,290
Registration No.	GBE8207	Chassis No.	MHYNC32S5RJ103902
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	Wagon
Colour	Gray		

Body / Panel Condition



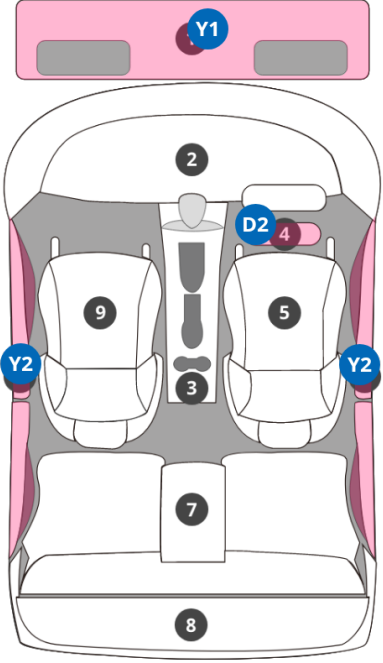
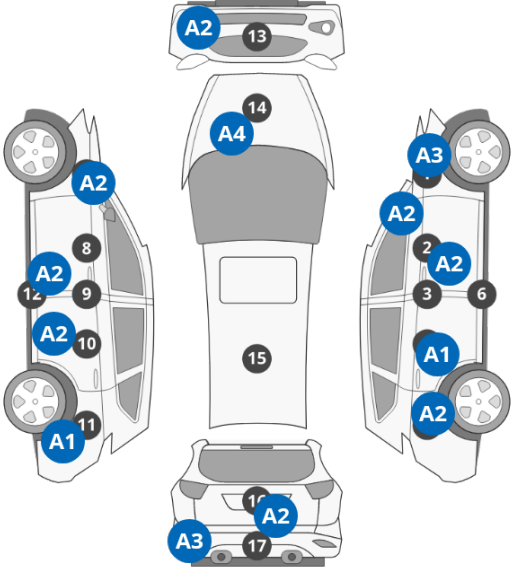
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	93.6	100	86	95
2	Boot Lid	82.0	76	84	86
3	Roof	80.9	78	73	88/85
4	Left Front Fender	79.8	79	78	82
5	Left Front Door	93.5	96	89	96
6	Center Panel Left				
7	Left Rear Door	92.8	98	92	89
8	Left Back Panel	83.7	93	87	71
9	Right Front Fender	83.7	90	83	79
10	Right Front Door	98.6	104	94	99
11	Center Panel Right				
12	Right Rear Door	99.3	95	94	110
13	Right Back Panel	85.0	75	85	95

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Trim - Grime - Small / Ceiling - Grime - Minimal / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small</p>	<p>Remarks (R) Front Door, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Large / (R) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Defects not found</p>

<p>Inspector Notes</p>
<p>With warranty booklwt,spare tire,jack,tools and seat cover. 2 keys. With LTO plate.</p>