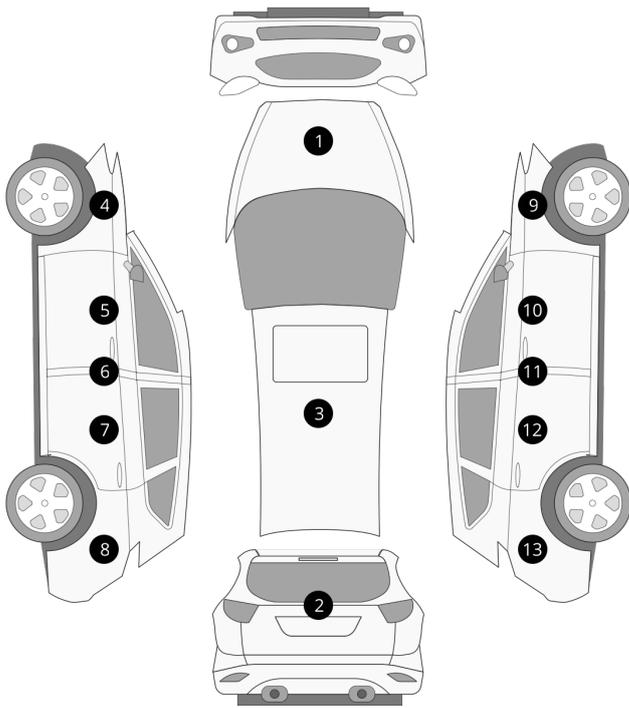


General Information

Date & Time: 05, Nov, 2025 21:33

Make	Toyota	Model	Innova
YOM	2024	Odo Meter Reading	3,467
Registration No.	GBE8750	Chassis No.	PA2JA8EM2R0143234
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Black		

Body / Panel Condition



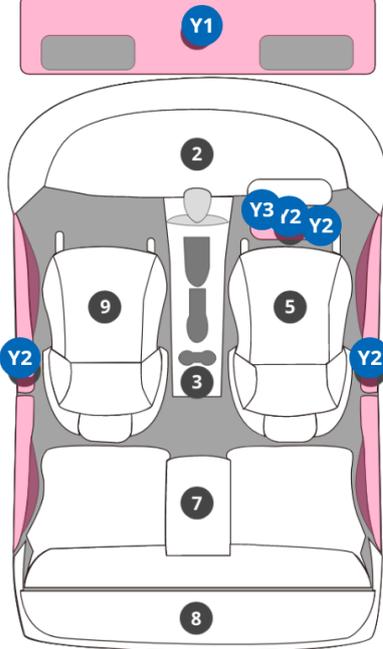
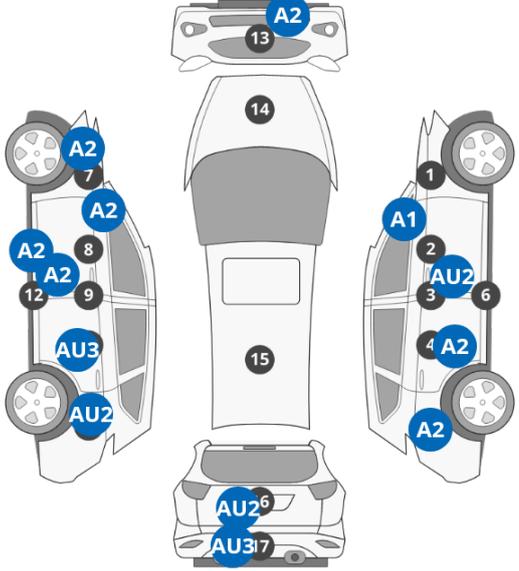
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.0	101	107	101
2	Boot Lid	92.5	91	90	97
3	Roof	90.7	88	86	94/95
4	Left Front Fender	93.8	94	100	88
5	Left Front Door	89.9	92	92	86
6	Center Panel Left				
7	Left Rear Door	95.8	103	95	90
8	Left Back Panel	91.9	94	86	96
9	Right Front Fender	90.1	77	94	99
10	Right Front Door	89.2	81	95	92
11	Center Panel Right				
12	Right Rear Door	92.6	96	96	86
13	Right Back Panel	99.5	101	99	98

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Minimal / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Small / Mat Other - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Grime - Medium</p>	<p>Remarks Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes</p>

<p>Inspector Notes</p>
<p>With warranty booklet, spare tire and seat cover. Without tools and jack. 2 keys. With LTO plate</p>